C137 (BK)

14290

Windshield washer pump motor (17618)

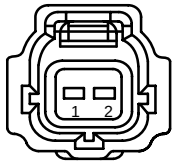

F02091

Pin	Circuit	Circuit function
1	941 (BK/WH)	Windshield washer pump motor (17618), feed
2	57 (BK)	Ground

C139 (BK)

14290

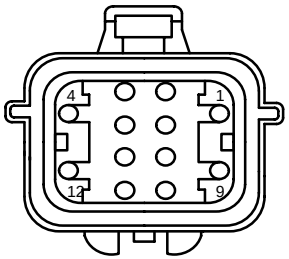

F12062

14A280

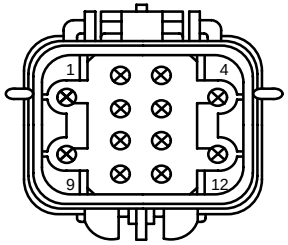

F12045

(1) –
(2) 441 (RD/YE)
(3) 57 (BK)
(4) –
(5) 570 (BK/WH)
(6) 321 (GY/WH)
(7) –
(8) 253 (DG/WH)
(9) 113 (YE/LB)
(10) –
(11) 904 (LG/RD)
(12) –

C142 (BU)

12B637

Heated Oxygen Sensor (HO2S) #12 (9G444)

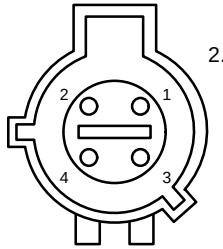

2.3L, 3.0L, 4.0L automatic transmission

F04082

Pin	Circuit	Circuit function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	89 (OG)	signal, return – 2.3L, 3.0L
	359 (GY/RD)	signal, return – 4.0L
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

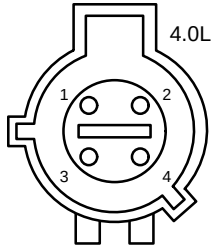

4.0L manual transmission

F04082

Pin	Circuit	Circuit function
1	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
2	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
3	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input
4	359 (GY/RD)	signal, return