COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Check Power and Grounds Before Any Other Tests	E and all others except H	All 3 Switches at Rest	Closed Circuit
	E and H	All 3 Switches at Rest	Open Circuit
Front Tilt Circuit	C and H	Up	Closed Circuit
	B and H	Down	Closed Circuit
Rear Tilt Circuit	A and H	Up	Closed Circuit
	D and H	Down	Closed Circuit

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Horizontal Movement	G and H	Forward	Closed Circuit
	F and H	Rearward	Closed Circuit

SCHEMATIC

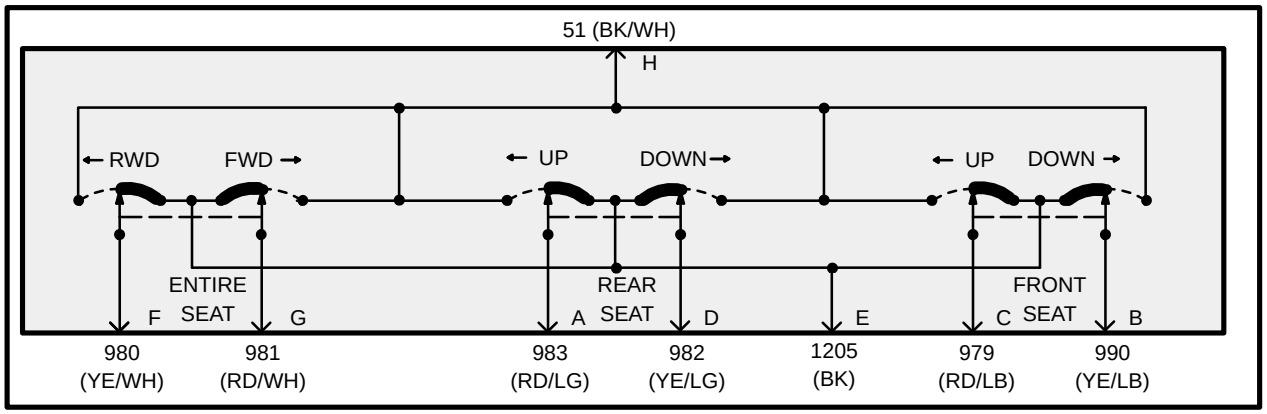
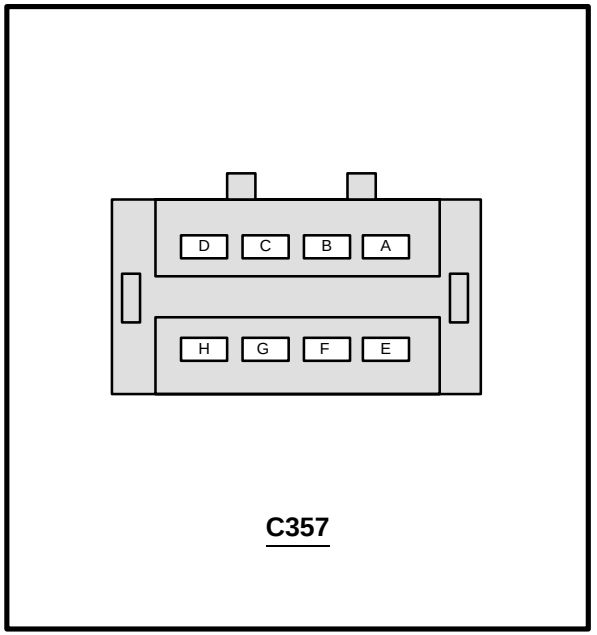
TERMINALS