Component Testing – Relay

SCHEMATIC

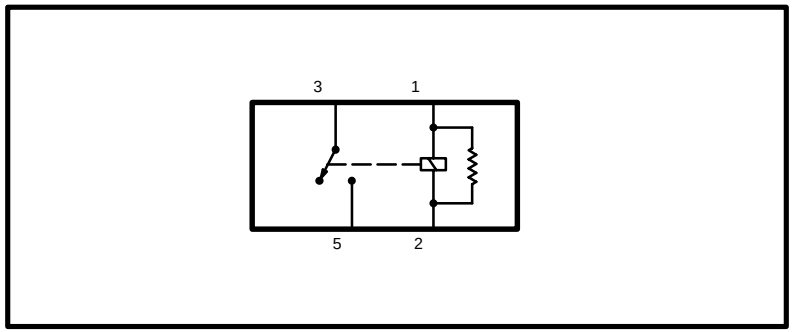

TERMINAL LOCATIONS

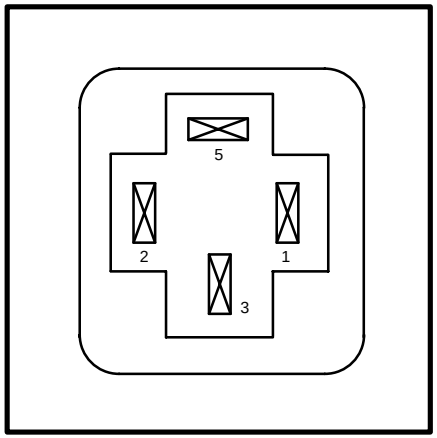

COMPONENT TESTING PROCEDURE (no voltage applied)

TO TEST	Connect Ohmmeter to Terminals	A Good Relay Will Indicate
Coil	1 and 2	50–100 ohms
Contact	3 and 5	Open Circuit
Coil–Contact	2 and 3	Open Circuit
	2 and 5	Open Circuit

COMPONENT TESTING PROCEDURE (voltage applied)

Disconnect the ohmmeter; connect pins 3 and 1 to 12V DC power and pin 2 to ground. Measure voltage between pin 5 and pin 2. If the voltage is 12V, continue with the test. If not, replace the relay.