C140

12B637

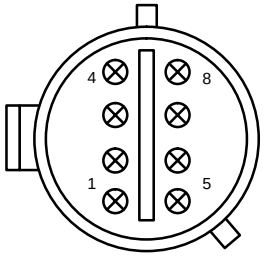

F08050

(1) 359 (GY/RD)
(2) 968 (TN/LB)
(3) 967 (LB/RD)
(4) 743 (GY)
(5)
(6)
(7) 361 (RD)
(8) 570 (BK/WH)

12B637

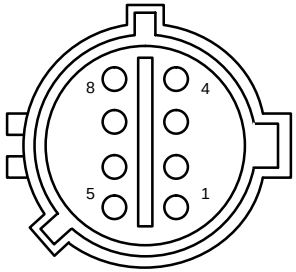

F08052

(1) 359 (GY/RD)
(2) 968 (TN/LB)
(3) 967 (LB/RD)
(4) 743 (GY)
(5)
(6) 361 (RD)
(7) 570 (BK/WH)
(8)

C142

12B637

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

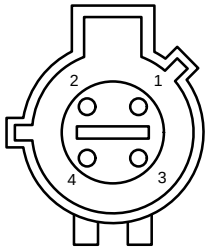

F04075

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #21 (9F472), input

C141

12B637

B87
Heated Oxygen
Sensor (HO2S) #22
(9G444)

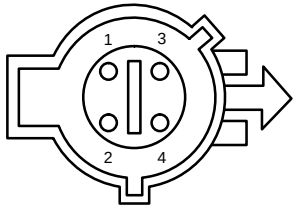

F04251

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

C143

12B637

B44
Turbine Shaft Speed
(TSS) sensor

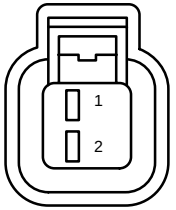

F02069

Pin	Circuit	Circuit function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine Shaft Speed (TSS) sensor