Component Testing – Ignition switch

SCHEMATIC

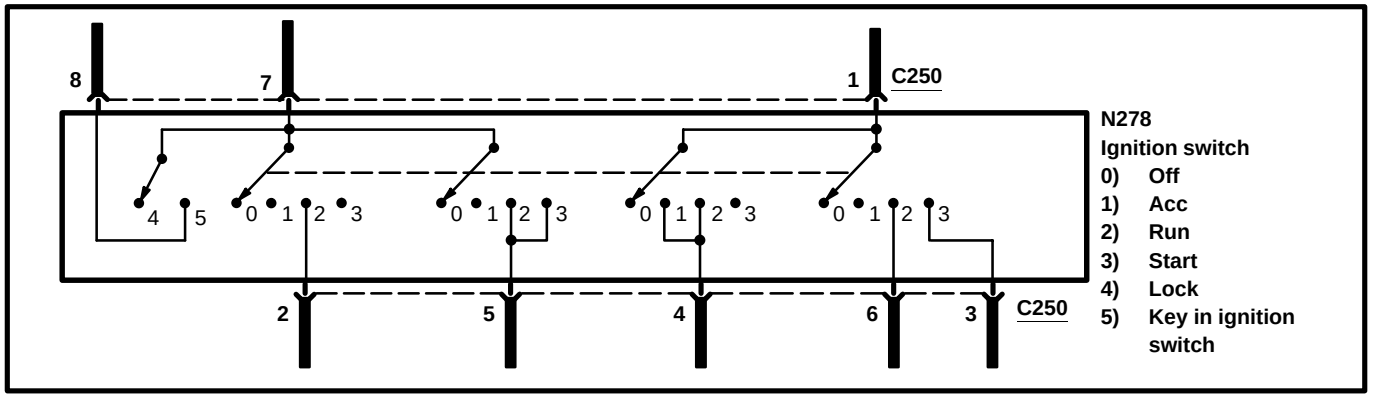

TERMINAL LOCATIONS

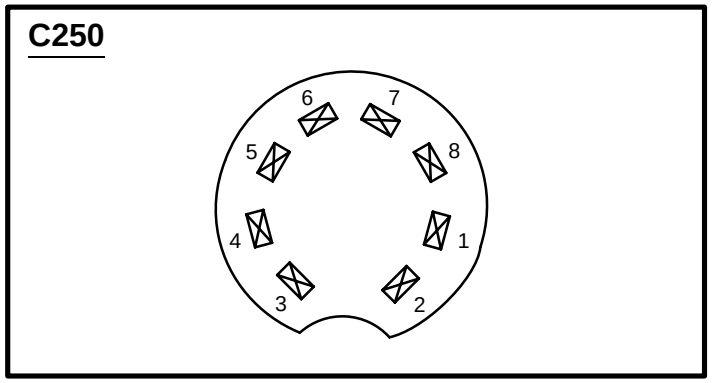

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Run Power Circuit	7 and 2 1 and 6	Off	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Open Circuit
Run/Start Power Circuit	7 and 5	Off	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Closed Circuit
Run/Acc Power Circuit	1 and 4	Off	Open Circuit
		Acc	Closed Circuit
		Run	Closed Circuit
		Start	Open Circuit
Start Power Circuit	1 and 3	Off	Open Circuit
		Acc	Open Circuit
		Run	Open Circuit
		Start	Closed Circuit
Key Reminder Circuit	1 and 8	Key Out	Open Circuit
		Key In	Closed Circuit