**COMPONENT TESTING PROCEDURE**

| TO TEST | Connect Self-Powered Test Light or Ohmmeter to Terminals | Move Switch to These Positions | A Good Switch Will Indicate |
|---|---|---|---|
| **Lock Switch Circuit** | 2 (C502) and 6 (C501) | Unlock | Closed Circuit |
| | | At Rest or Lock | Open Circuit |
| **Unlock Switch Circuit** | 5 (C502) and 6 (C501) | Lock | Closed Circuit |
| | | At Rest or Unlock | Open Circuit |
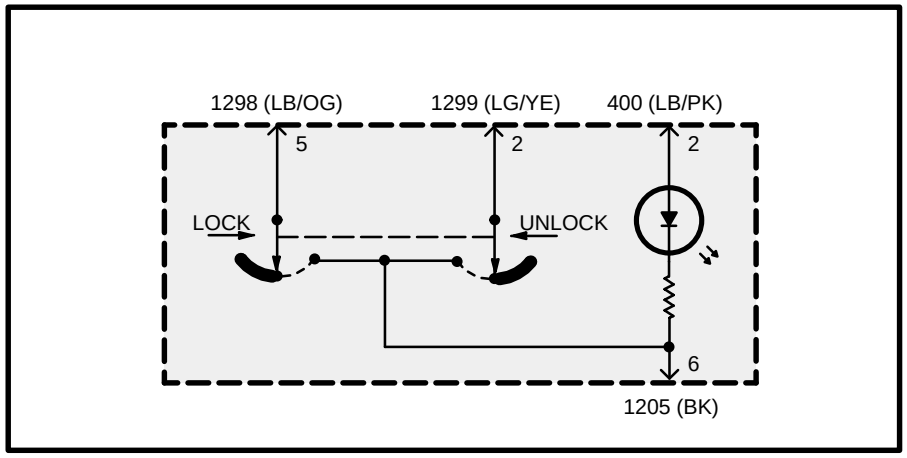
**DOOR LOCK SWITCH SCHEMATIC**