Multifunction switch

Schematic

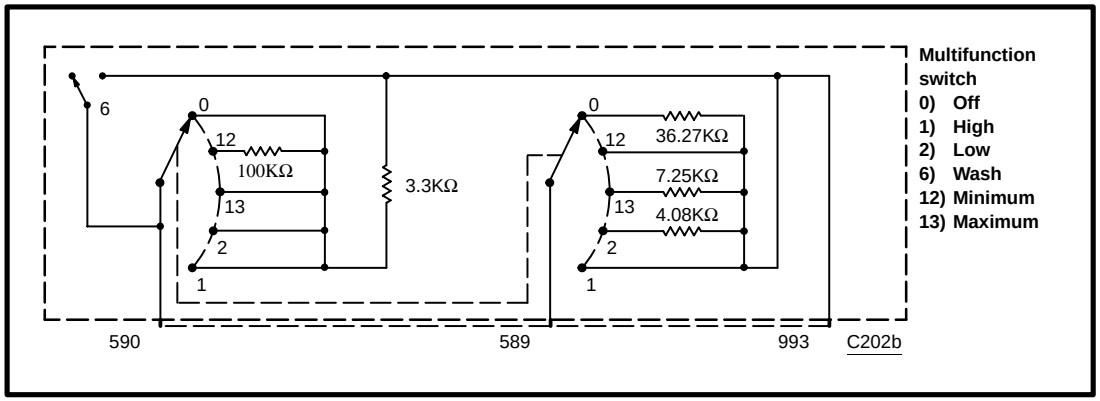

Terminals

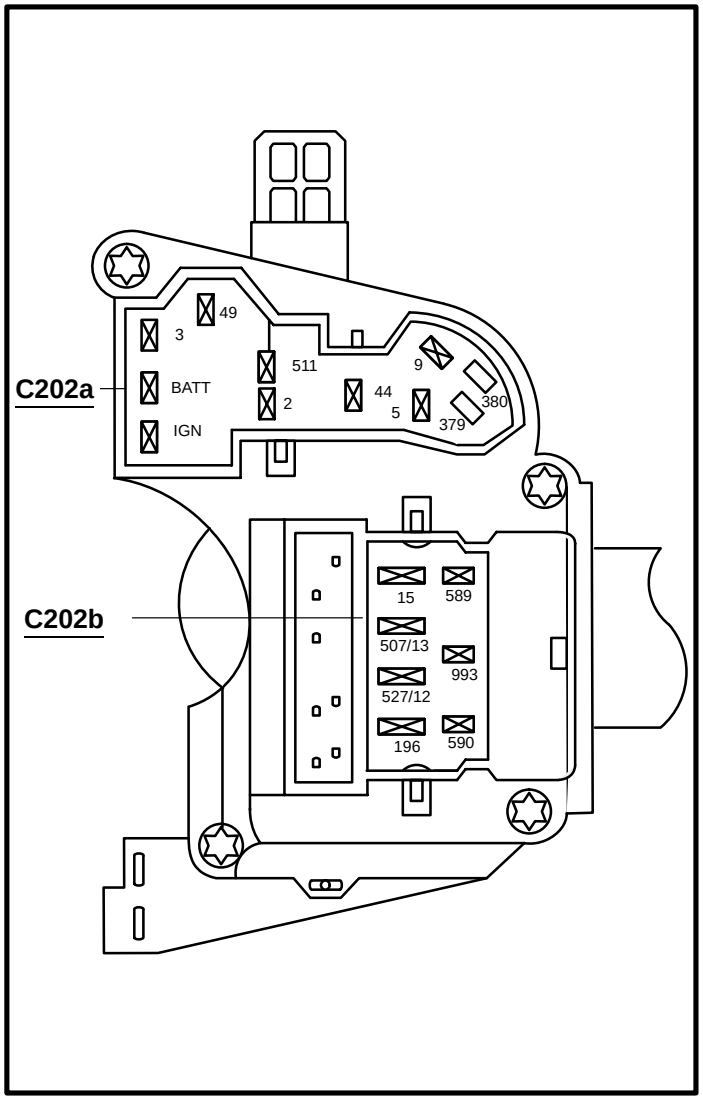

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	590 and 993	Wiper switch, Off, Washer switch normal	Open circuit
		Wiper switch, Off, Washer switch depressed	Closed circuit
Washer switch circuit	589 and 590	Off	47.6KΩ
		Intermittent	11.33KΩ
		Low	4.08KΩ
		High	Closed circuit
Intermittent wiper circuit	590 and 993	Off	101.1KΩ
		Intermittent	1.1KΩ –101.1KΩ
		Low	1.1KΩ
		High	1.1KΩ