Power window switch, RH side front

Schematic

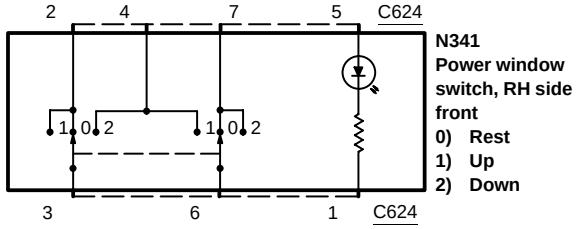

N341
Power window switch, RH side front
0) Rest
1) Up
2) Down

Terminals

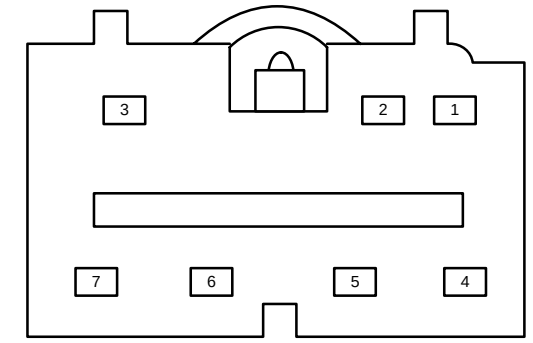

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Down Switch Circuit	4 and 3	Down	Closed circuit
	2 and 3	at rest, Up	Closed circuit
Up Switch Circuit	4 and 6	Up	Closed circuit
	7 and 6	at rest, Down	Closed circuit