C137

14290

M112
Windshield washer
pump motor (17618)

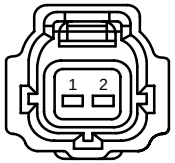

F02091

Pin	Circuit	Circuit function
1	686 (TN/RD)	Washer motor relay, control
2	571 (BK/OG)	Ground

C139

14A280

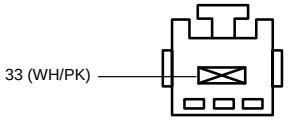

F01089

14290



F01029

C140

14290

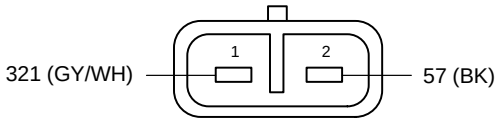

F02305

19B573

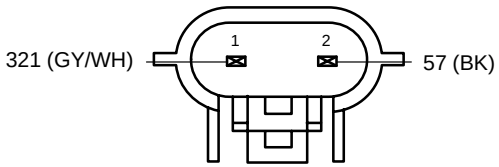

F02491

C141

12A522

B87
Heated Oxygen
Sensor (HO2S) #22
(9F472)

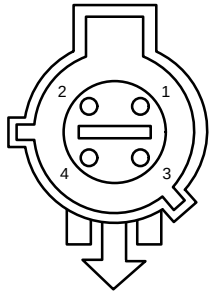

F04251

Pin	Circuit	Circuit function
1	34 (LB/OG)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9F472), heater
3	89 (OG)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9F472), input