Multifunction switch (continued)

Schematic

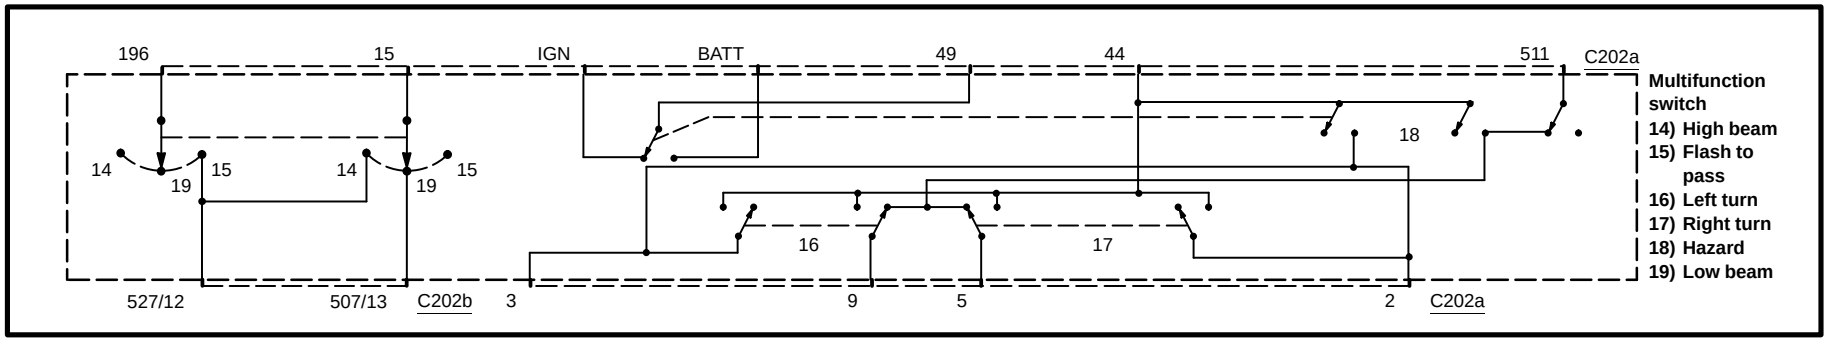

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Turn signal	44, 9 and 3	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
	44, 5 and 2	Hazard switch to Normal (Off) and Turn switch to Right	Closed circuit
Hazard	44, 2, 3, 5 and 9	Hazard switch to Hazard (On) (Button pushed in and then released to fully extended position)	Closed circuit
	511, 5 and 9	Hazard switch to Normal (Off) and Turn switch to Neutral	Closed circuit
Flash–to–pass	196 and 12	Pull and hold lever stalk toward steering wheel	Closed circuit
High beam	12 and 15	Lever stalk in detent away from steering wheel	Closed circuit
Low beam	15 and 13	Lever stalk in detent to-ward steering wheel	Closed circuit