Schematic

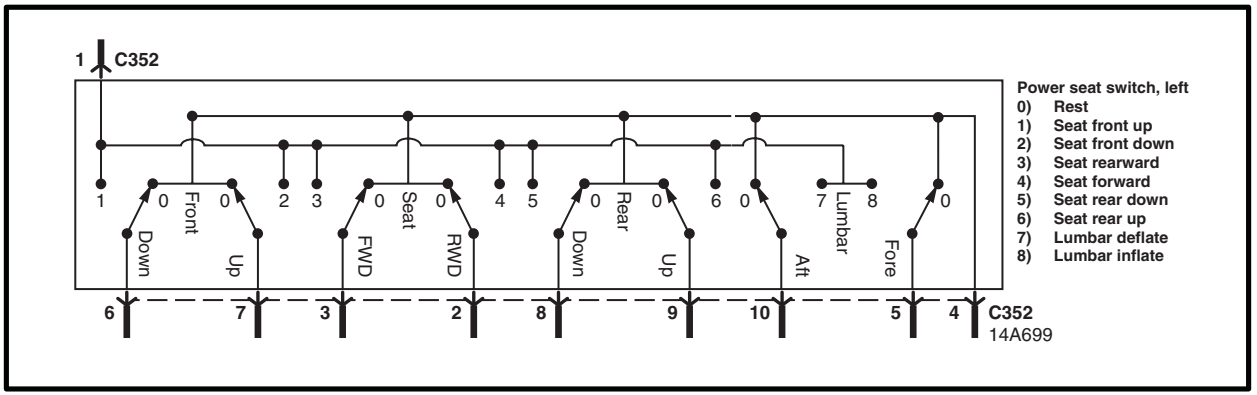

Terminals

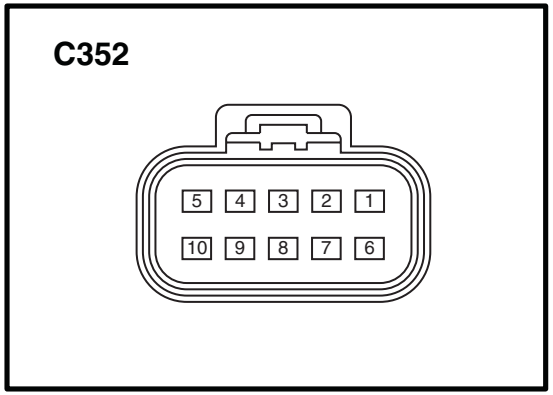

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Forward/Rearward circuit	8 and 1 8 and 4	Forward	Closed circuit
		Rearward	Closed circuit
	9 and 4 9 and 1	Forward	Closed circuit
		Rearward	Closed circuit
Front up/down circuit	6 and 1 6 and 4	Up	Closed circuit
		Down	Closed circuit
	7 and 4 7 and 1	Up	Closed circuit
		Down	Closed circuit
Rear up/down circuit	3 and 1 3 and 4	Up	Closed circuit
		Down	Closed circuit
	2 and 4 2 and 1	Up	Closed circuit
		Down	Closed circuit