Schematic

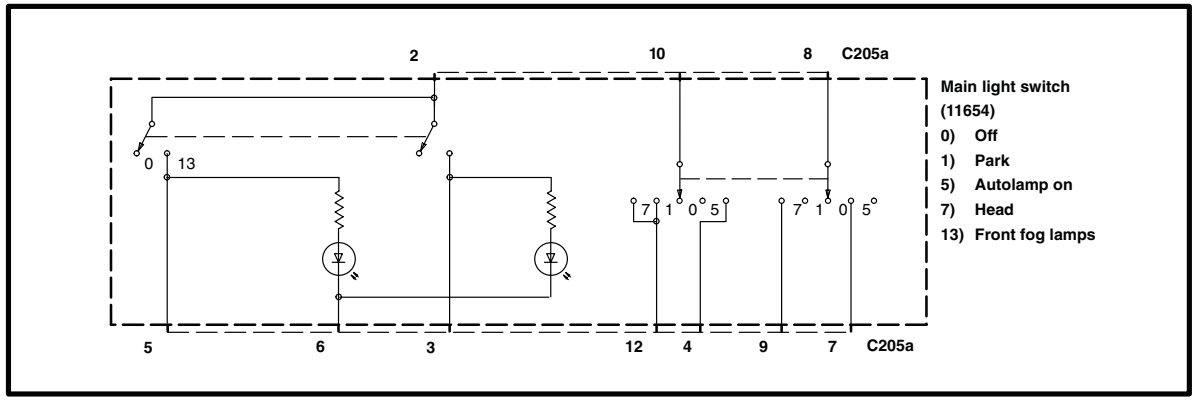

Terminals

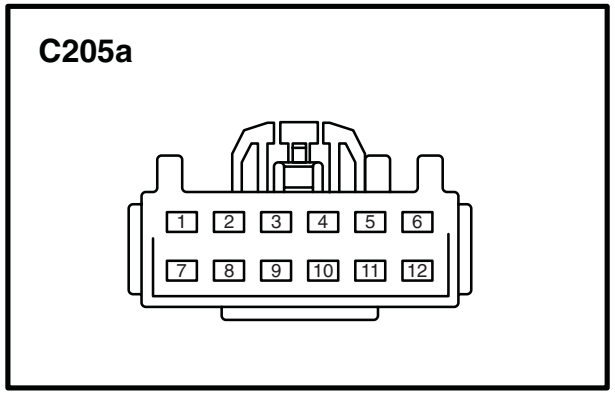

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Headlamp	8 and 9	Off	Open circuit
		Head	Closed circuit
		Park	Open circuit
Park lamps	10 and 12	Off	Open circuit
		Head	Closed circuit
		Park	Closed circuit
Fog lamps	2 and 5	Off	Open circuit
		On	Closed circuit
Autolamps	7 and 8	Off	Open circuit
		On	Closed circuit