Main light switch (11654)

Schematic

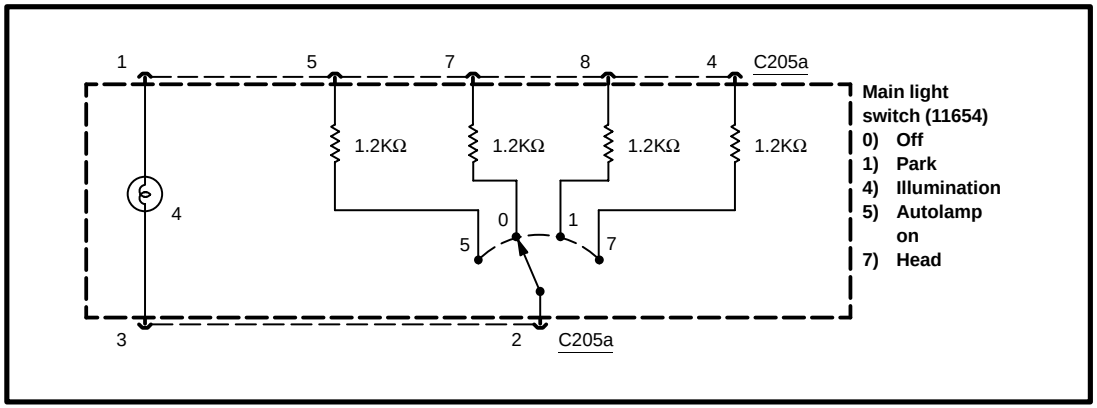

Terminals

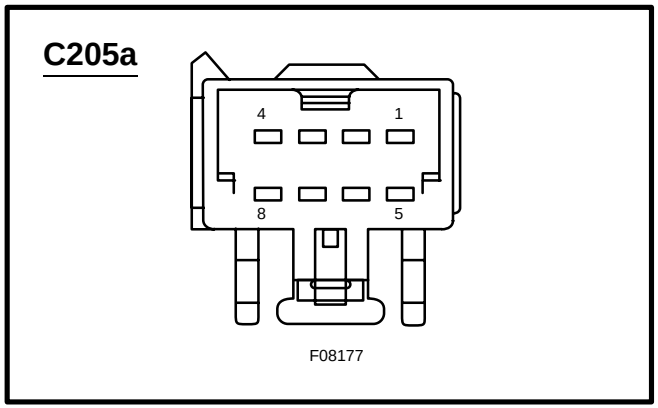

Component testing procedure

Circuit to test	Connect ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Headlamp circuit	4 and 2	Autolamps	Open circuit
		Off	Open circuit
		Park	Open circuit
		Head	1.2k Ω
Parking lights circuit	8 and 2	Autolamps	Open circuit
		Off	Open circuit
		Park	1.2k Ω
		Head	Open circuit
Off	7 and 2	Autolamps	Open circuit
		Off	1.2k Ω
		Park	Open circuit
		Head	Open circuit
Autolamp Circuit	5 and 2	Autolamps	1.2k Ω
		Off	Open circuit
		Park	Open circuit
		Head	Open circuit