C140

12A581

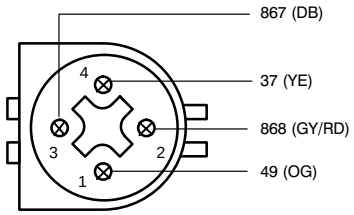

F04213

14A411

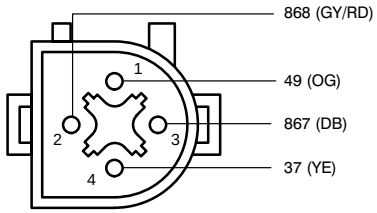

F04081

C141

7C078

B87
Heated Oxygen
Sensor (HO2S) #22
(9G444)

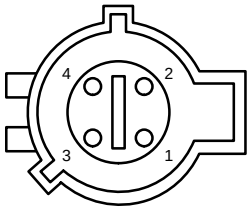

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

C142

7C078/9K499

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

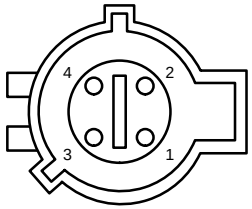

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143

7C078

B44
Turbine Shaft Speed
(TSS) sensor

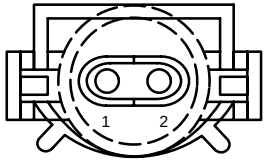

F02031

Pin	Circuit	Circuit function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine Shaft Speed (TSS) sensor