C140 (BK)

12B637

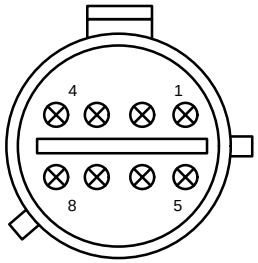

F08050

(1) 743 (GY)
(2) 967 (LB/RD)
(3) 968 (TN/LB)
(4) 359 (GY/RD)
(5) 570 (BK/WH)
(6) 361 (RD)
(7)
(8)

12A690

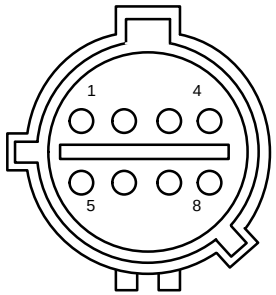

F08052

(1) 743 (GY)
(2) 967 (LB/RD)
(3) 968 (TN/LB)
(4) 359 (GY/RD)
(5) 570 (BK/WH)
(6) 361 (RD)
(7)
(8)

C142 (BL)

12B637

Heated Oxygen Sensor (HO2S) #12 (9G444)

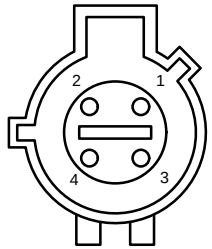

F04075

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C141 (BL)

12B637

Heated Oxygen Sensor (HO2S) #22 (9G444)

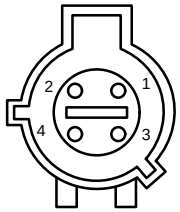

F04251

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

C143 (BK)

12B637

Turbine shaft speed sensor (7M101)

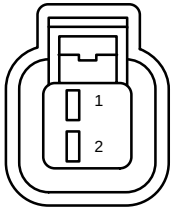

F02069

Pin	Circuit	Circuit function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine shaft speed sensor (7M101)