COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Internal Switch Connections (perform these tests first)	BATT and BATT	Acc, Lock, Off, Run, Start	Closed Circuit in all five positions
	A2 and A2	Acc, Lock, Off, Run, Start	Closed Circuit in all five positions
Starter Relay Circuit	BATT (either terminal) and ST	Acc, Lock, Off, Run, Start	Closed Circuit in Start position only
A/C, Heater Circuit	BATT (either terminal) and A2 (terminal next to P2)	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only

TERMINALS

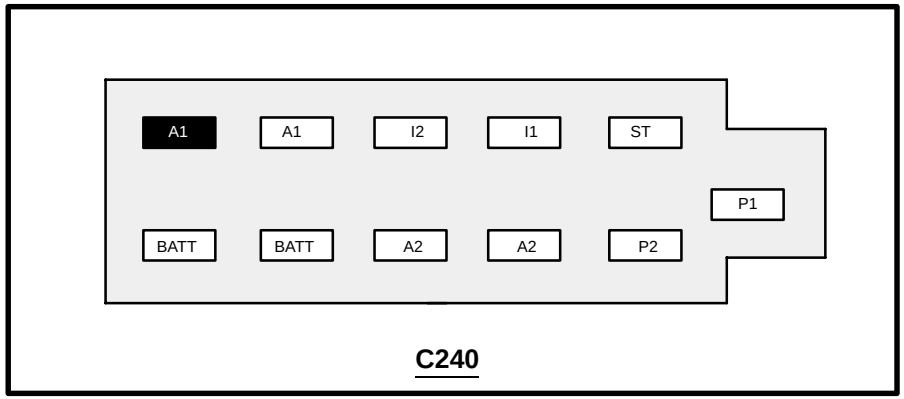

C240

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Ignition Coil Circuit	BATT (either terminal) and I1	Acc Lock, Off, Run, Start	Closed Circuit in Run position only
	BATT (either terminal) and I2	Acc Lock, Off, Run, Start	Closed Circuit in Start position only
Acc Power Circuit	BATT (either terminal) and A1	Acc Lock, Off, Run, Start	Closed Circuit in Run and Acc position only
Bulb Prove-Out Circuit	P2 or P1 and Ignition Switch Case	Acc Lock, Off, Run, Start	Closed Circuit in Start position only