TERMINALS

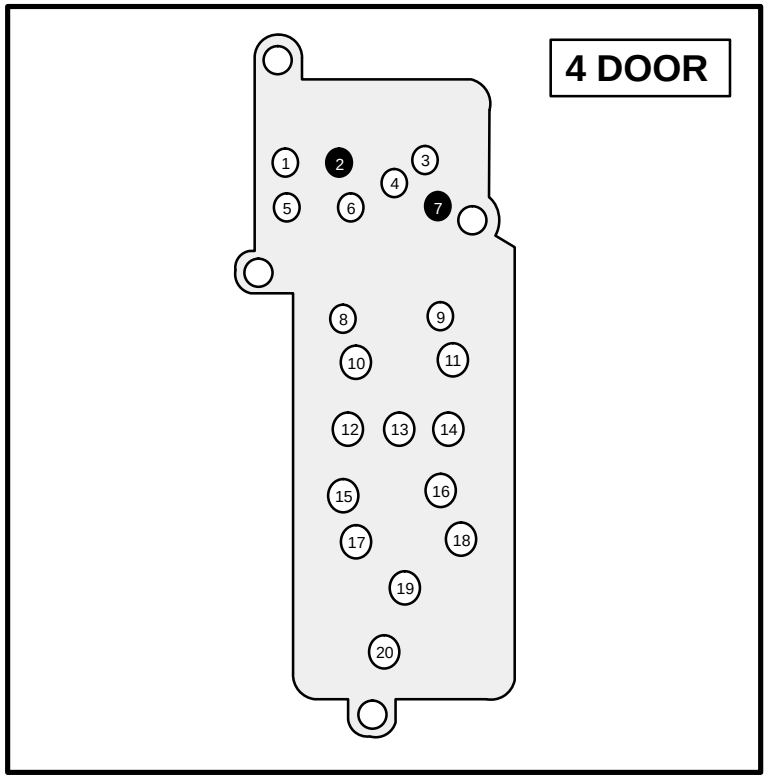

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Front Window	19 and 8 19 and 10	Up Down	Closed Circuit Closed Circuit
Right Front Window	19 and 9 19 and 11	Up Down	Closed Circuit Closed Circuit
Left Rear Window	19 and 15 19 and 17	Up Down	Closed Circuit Closed Circuit
Right Rear Window	19 and 16 19 and 18	Up Down	Closed Circuit Closed Circuit
Window Lock Switch	19 and 20	Lock Unlock	Open Circuit Closed Circuit
Door Lock Switch	6 and 4 3 and 4	Lock Unlock	Closed Circuit Closed Circuit
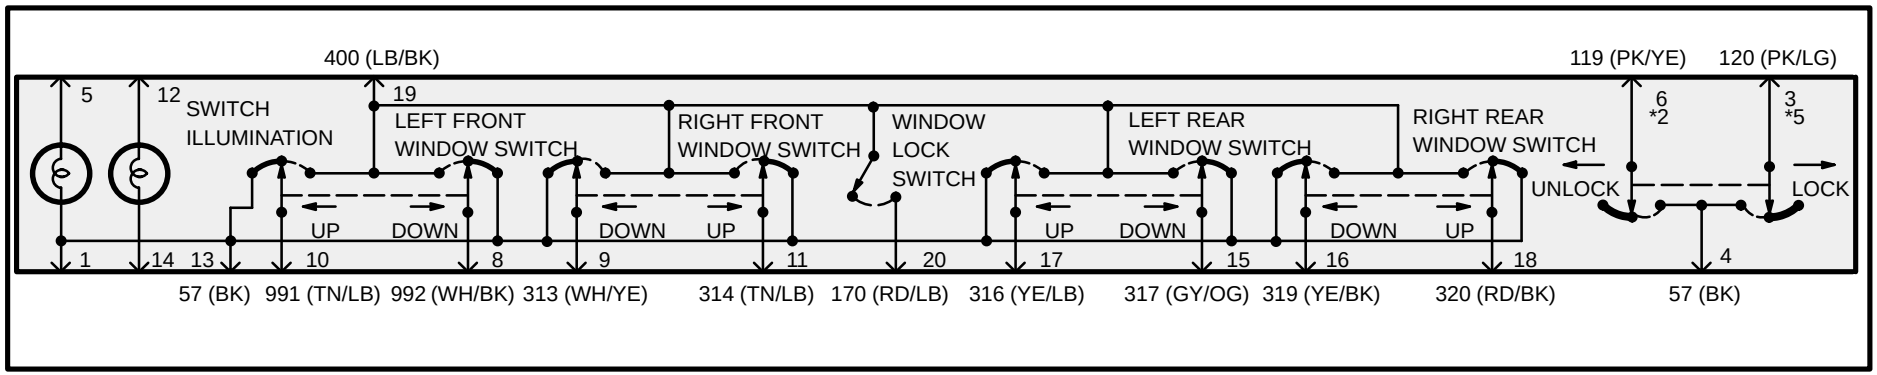
SCHEMATIC