C141 (BU)

12B637

Heated Oxygen Sensor (HO2S) #22 (9G444)

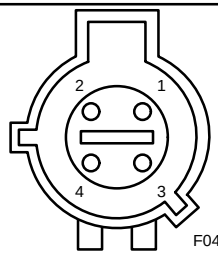

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

C142 (BU)

12B637

Heated Oxygen Sensor (HO2S) #12 (9G444)

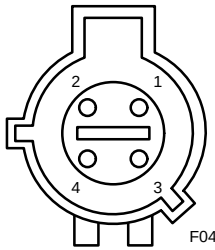

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	388 (YE/LB)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	94 (RD/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143 (BK)

12B637

Turbine shaft speed sensor (7M101)

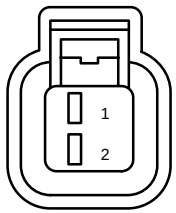

F02069

Pin	Circuit	Circuit function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine shaft speed sensor (7M101)

C150 (WH)

14290

Wheel speed sensor, left front (2C205)

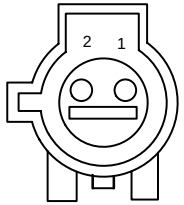

F02489

Pin	Circuit	Circuit function
1	521 (TN/OG)	Wheel speed sensor, left front (2C205) +
2	522 (TN/BK)	Wheel speed sensor, left front (2C205) +

C152 (BK)

14290

Fog lamp, left front (15200)

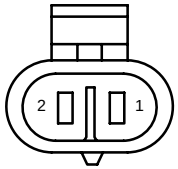

F02038

Pin	Circuit	Circuit function
1	57 (BK)	Ground
2	478 (TN/OG)	Fog lamp relay, to front fog lamp

C160 (WH)

14290

Wheel speed sensor, right front (2C204)

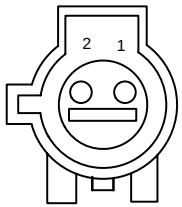

F02489

Pin	Circuit	Circuit function
1	516 (YE/BK)	Wheel speed sensor, right front (2C204) -
2	514 (YE/RD)	Wheel speed sensor, right front (2C204) +