COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Starter Relay Circuit	B4 and STA	Acc, Lock, Off, Run, Start	Closed Circuit in Start position only

TERMINALS

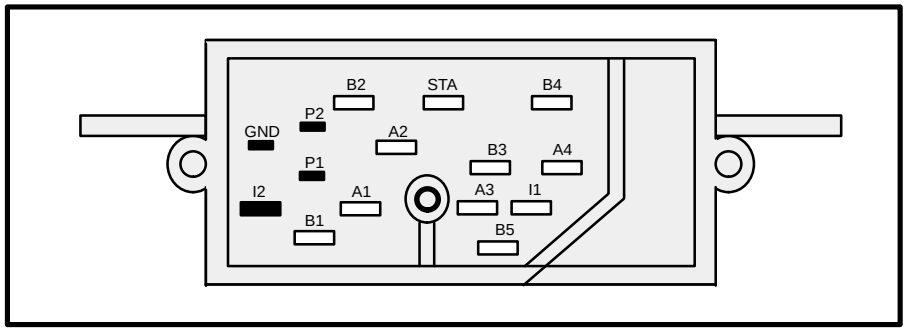

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Ignition Coil Circuit	B5 and I1	Acc, Lock Off, Run, Start	Closed Circuit in Start and Run positions only
Acc Power Circuit	B5 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Acc position only
Run Power Circuit	B1 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
	B2 and A2	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
	B3 and A3	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
	B4 and A4	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
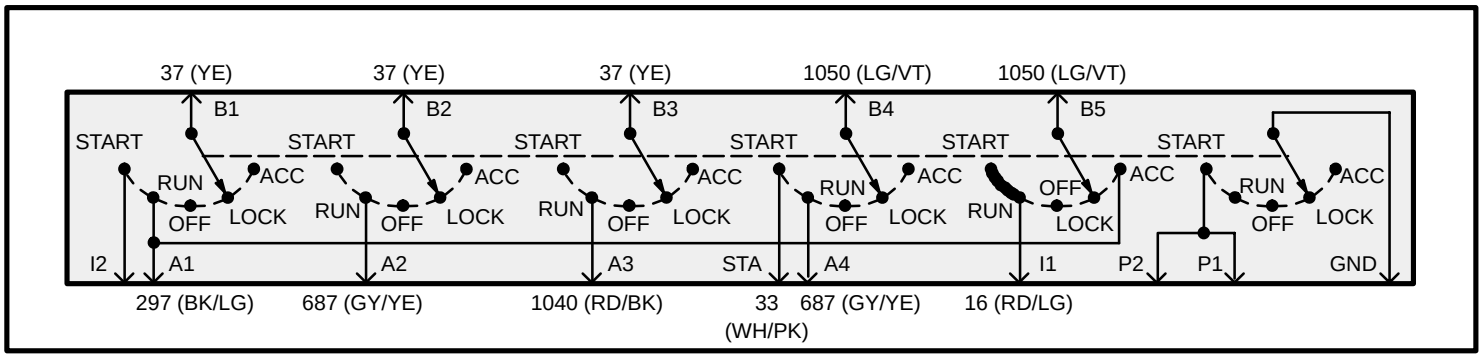
SCHEMATIC