Multifunction Switch, Lamp Portion

Schematic

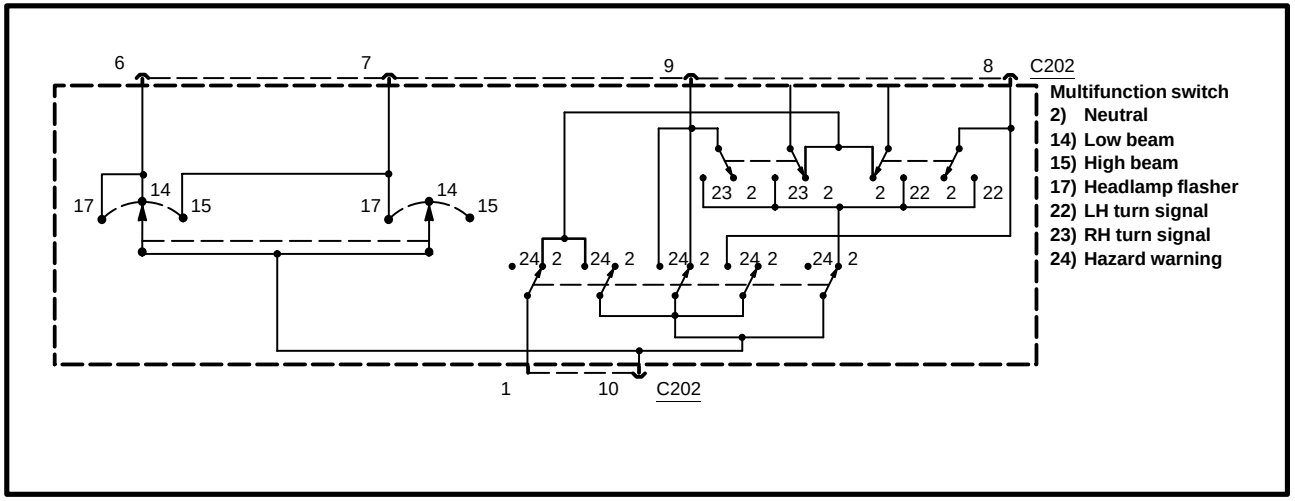

Terminals

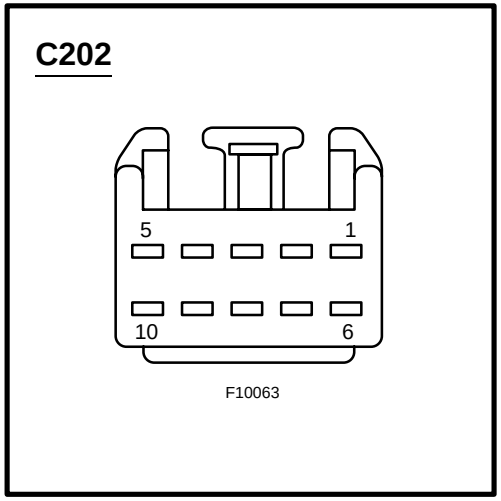

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Flash–to–pass	10 and 7 10 and 6	Pull and hold lever stalk toward steering wheel	Closed circuit
High beam	10 and 7	Lever stalk in detent away from steering wheel	Closed circuit
Low beam	10 and 6	Lever stalk in detent toward steering wheel	Closed circuit
Turn signal	10 and 8	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
	10 and 9	Hazard switch to Normal (Off) and Turn switch to Right	Closed circuit
Hazard	10 and 8 10 and 9	Hazard switch to Hazard (On) (Button pushed in and then released to fully extended position)	Closed circuit