Master window/door lock/unlock switch – front power windows

Schematic

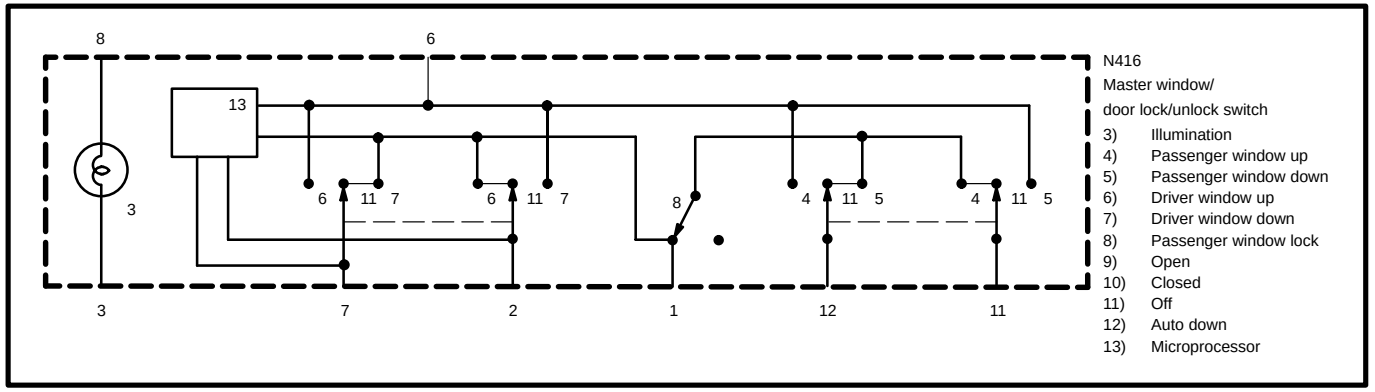

Terminal locations

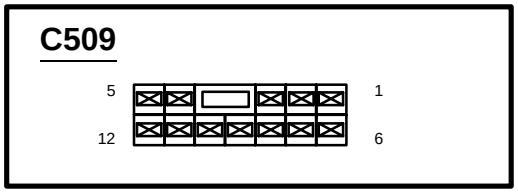

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Power and Ground Checks Before Any Other Tests	6 and 1	all positions	Open circuit
Left front window circuit	6 and 7 1 and 2	Up	Closed circuit
	6 and 2 1 and 7	Down	Closed circuit
Right front window circuit	6 and 12 1 and 11	Up	Closed circuit
	6 and 11 1 and 12	Down	Closed circuit