Multifunction Switch, Wiper/Washer Portion

Schematic

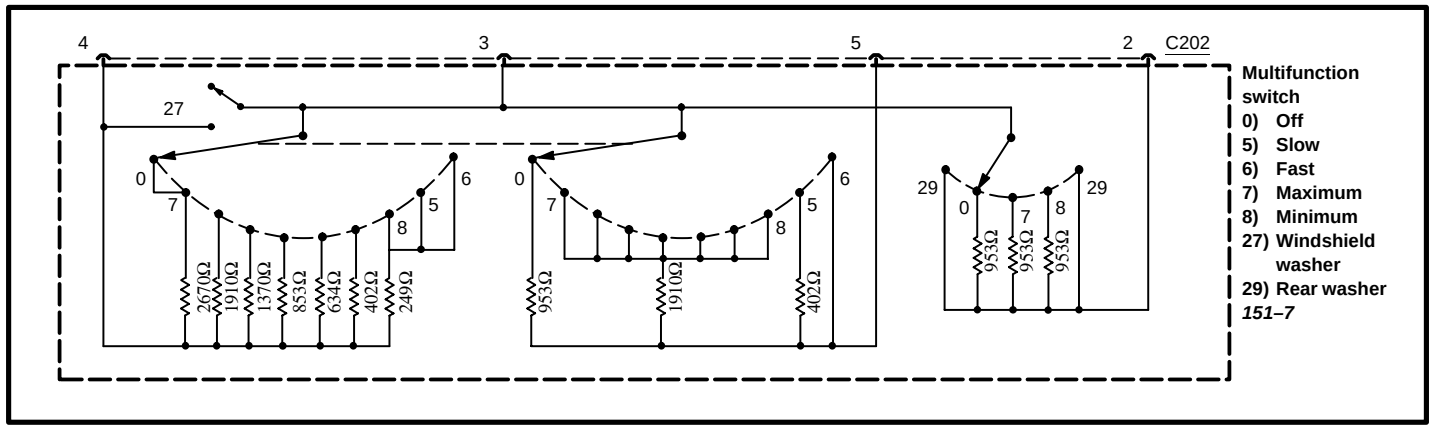

Terminals

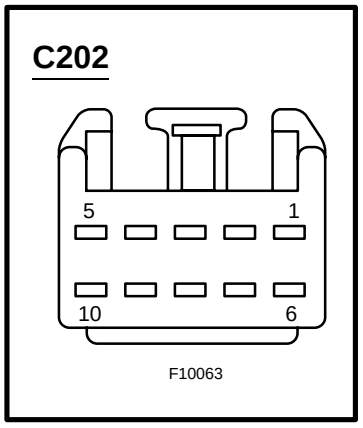

Component testing procedure

Circuit to test	Connect ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	3 and 4	Washer switch de-pressed	Closed circuit
		Washer switch normal	2670Ω
Wiper switch circuit	3 and 5	Off	953Ω
		Intermittent	1910Ω
		Low	4.02Ω
		High	Closed circuit
Intermittent wiper circuit	3 and 4	Intermittent and Off	Rotate control toward Off; ohmmeter will show smoothly increasing resistance from 3.3kOhm minimum to 103.3kOhm maximum.
		Low and High	249Ω
Rear wiper switch circuit	3 and 2	Off	1910Ω
		Intermittent 1	953Ω
		Intermittent 2	402Ω
		Washer	Closed circuit