COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	2 and 1	All Four Switches (All Positions)	Open Circuit
	1 and all others except 3	All Four Switches (At Rest)	Closed Circuit
Left Front Window Circuit	2 and 4	Up	Closed Circuit
	2 and 5	Down	Closed Circuit
Right Front Window Circuit	2 and 7	Up	Closed Circuit
	2 and 6	Down	Closed Circuit
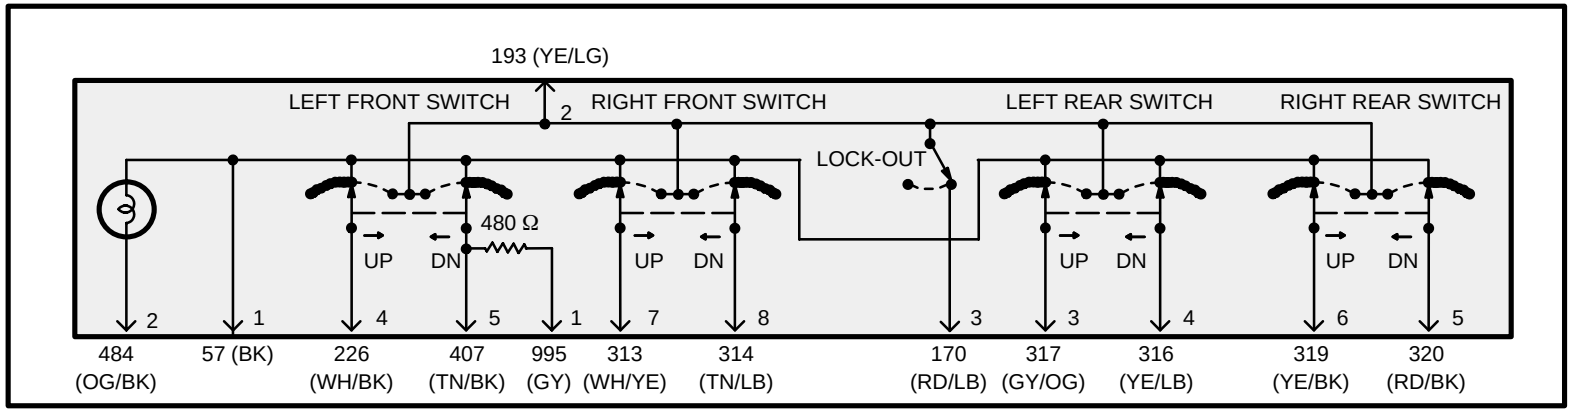
SCHEMATIC