Power window switches

Schematic

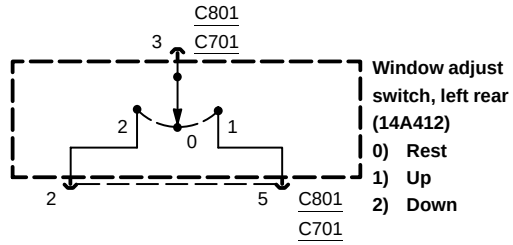

Terminals

C701
C801

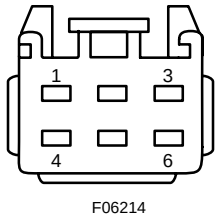

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Window adjust switches	3 and 5	Up	Closed circuit
		Down	Open circuit
		Off	Open circuit
	3 and 2	Up	Open circuit
		Down	Closed circuit
		Off	Open circuit