Pickup

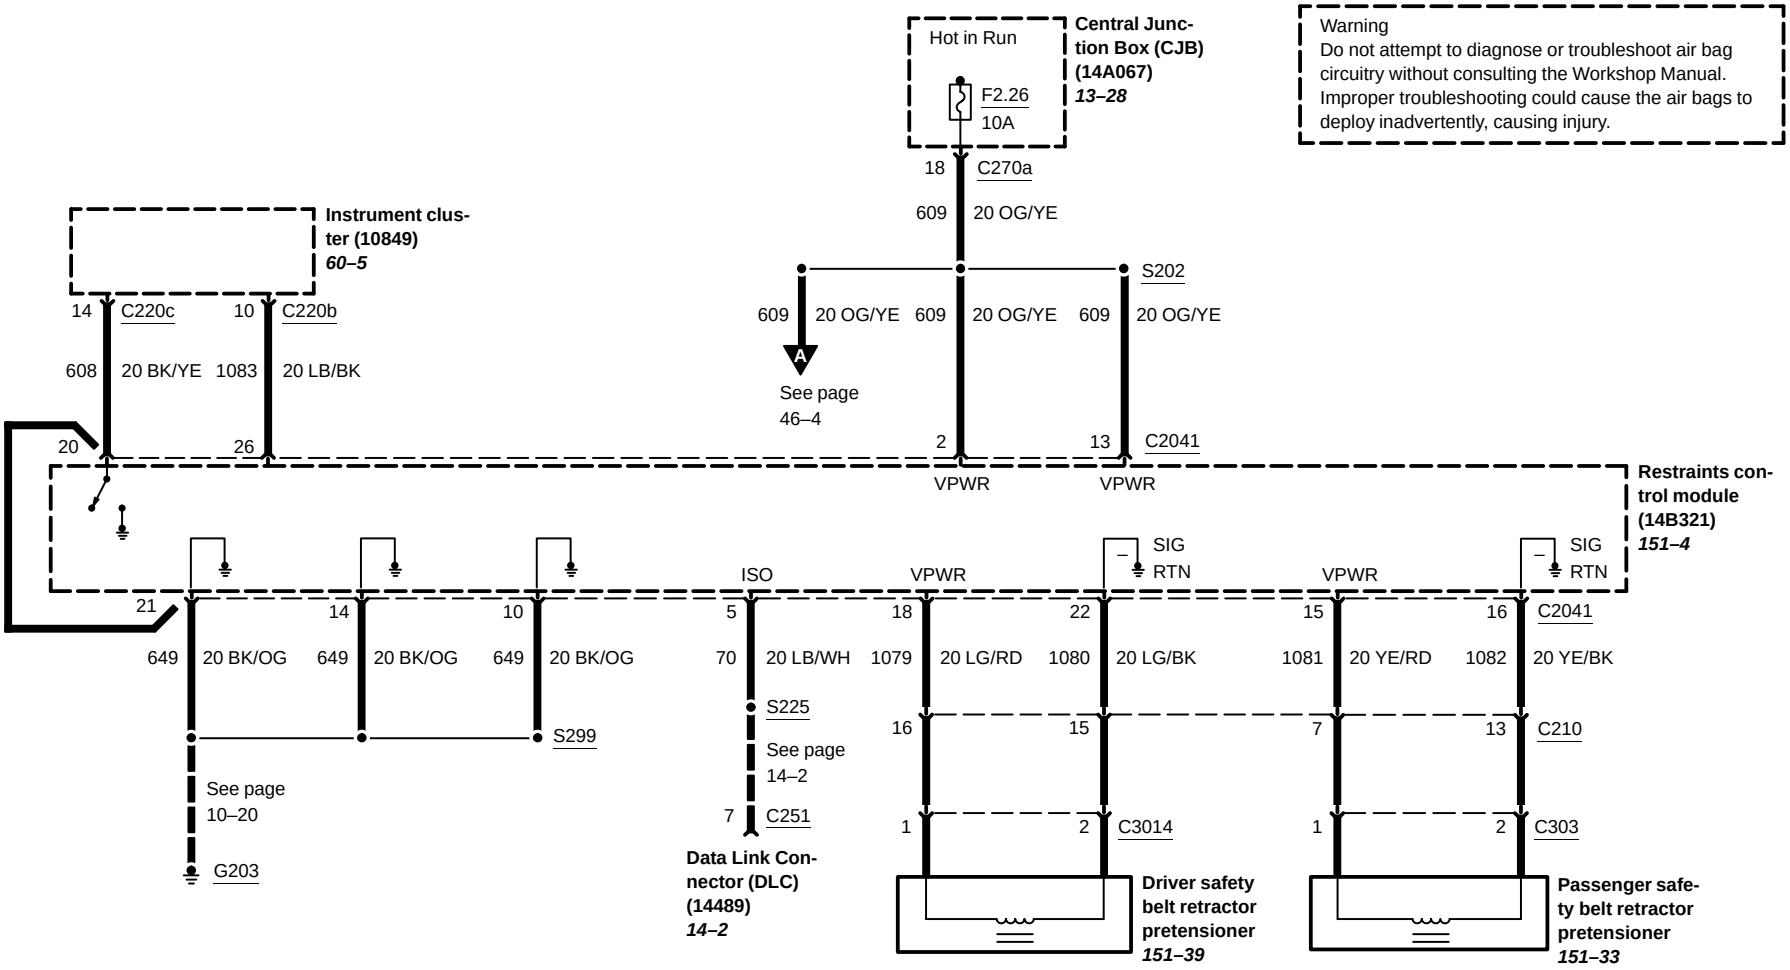
Hot in Run
F2.26
10A
Central Junction Box (CJB) (14A067) 13–28
18 C270a
609 20 OG/YE
Warning
Do not attempt to diagnose or troubleshoot air bag circuitry without consulting the Workshop Manual. Improper troubleshooting could cause the air bags to deploy inadvertently, causing injury.
Instrument cluster (10849) 60–5
14 C220c 10 C220b
608 20 BK/YE 1083 20 LB/BK
609 20 OG/YE
A
See page 46–4
609 20 OG/YE 609 20 OG/YE 609 20 OG/YE
S202
20 26
2 13 C2041
VPWR VPWR
Restraints control module (14B321) 151–4
21 14 10 5 18 22 15 16
649 20 BK/OG 649 20 BK/OG 649 20 BK/OG 70 20 LB/WH 1079 20 LG/RD 1080 20 LG/BK 1081 20 YE/RD 1082 20 YE/BK
ISO VPWR SIG RTN VPWR SIG RTN
C2041
S299
S225
See page 14–2
See page 10–20
16 15 7 13 C210
7 C251
1 2 C3014 1 2 C303
G203
Data Link Connector (DLC) (14489) 14–2
Driver safety belt retractor pretensioner 151–39
Passenger safety belt retractor pretensioner 151–33