COUPE

TERMINALS

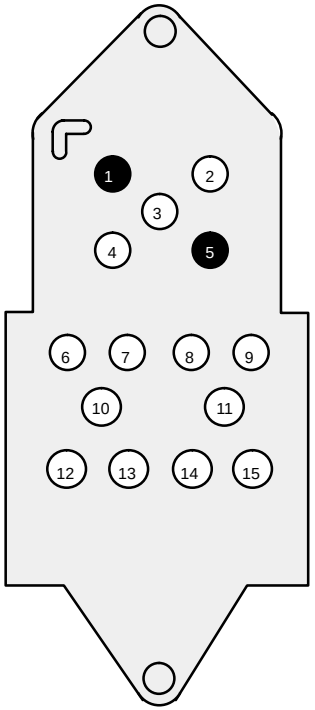

CONNECTOR VIEW

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Grounds Checks Before Any Other Tests	10 and 12, 10 and 7, 11 and 14, 11 and 9	Window Switches (All Positions)	Open Circuit
	12 and 6, 7 and 13, 14 and 15, 9 and 8	Window Switches (At Rest)	Closed Circuit
	3 and 4	Door Lock Switch (Lock Position)	Closed Circuit
	3 and 2	Door Lock Switch (Unlock Position)	Closed Circuit
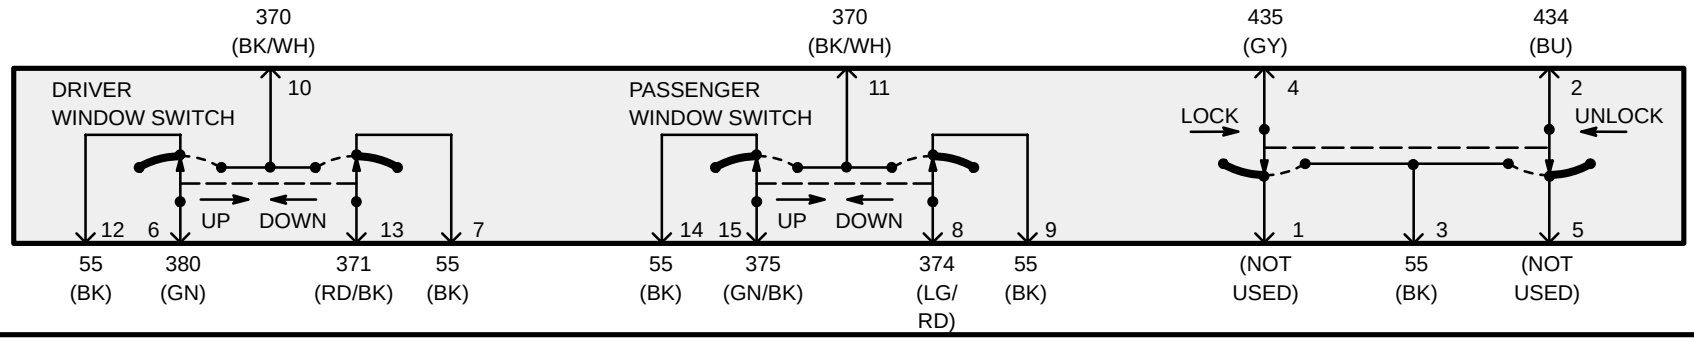
SCHEMATIC