C141 (BU)

12B637

B87
Heated Oxygen
Sensor (HO2S) #22
(9F472)

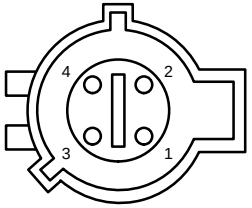

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9F472), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9F472), input

C142 (BU)

12B637

B88
Heated Oxygen
Sensor (HO2S) #12
(9F472)

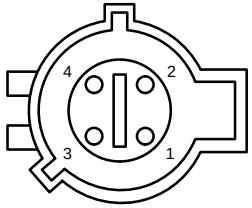

F04082

Pin	Circuit	Circuit function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	388 (YE/LB)	Heated Oxygen Sensor (HO2S) #12 (9F472), heater
3	359 (GY/RD)	signal, return
4	94 (RD/BK)	Heated Oxygen Sensor (HO2S) #12 (9F472), input

C143

12B637

B44
Turbine shaft speed
sensor (7M101)

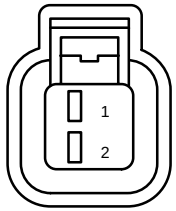

F02069

Pin	Circuit	Circuit function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine shaft speed sensor (7M101)

C150 (BK)

14290

B15
Wheel speed sen-
sor, left front
(2C205)

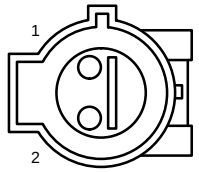

F02085

Pin	Circuit	Circuit function
1	521 (TN/OG)	Wheel speed sensor, left front (2C205) +
2	522 (TN/BK)	Wheel speed sensor, left front (2C205) +

C152

14290

E43
Fog lamp, left front
(15200)

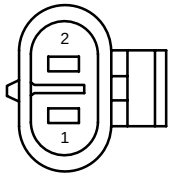

F02038

Pin	Circuit	Circuit function
1	57 (BK)	Ground
2	478 (TN/OG)	Fog lamp relay, to front fog lamp

C160

14290

B14
Wheel speed sen-
sor, right front
(2C204)

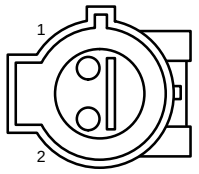

F02085

Pin	Circuit	Circuit function
1	516 (YE/BK)	Wheel speed sensor, right front (2C204) -
2	514 (YE/RD)	Wheel speed sensor, right front (2C204) +