Multifunction Switch, Lamp Portion

Schematic

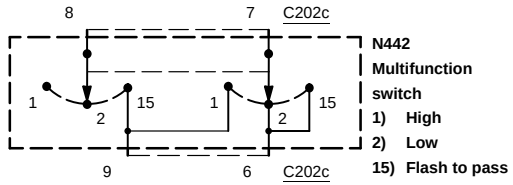

Terminals

C202c

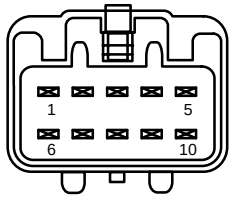

F10155

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
High beam	7 and 9	High beam	Closed circuit
		Flash–to–pass	Open circuit
		Low beam	Open circuit
Low beam/Flash–to–pass	6 and 7	High beam	Open circuit
		Flash–to–pass	Open circuit
		Low beam	Closed circuit
	8 and 9 6 and 7	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Open circuit