C7103M

Manual Trans Harness With 2-Speed Axle

2-speed axle boot connector

1661198C1

Pin	Circuit	Circuit Function
A	417 (VT/OG)	Run feed to axle switch
B	—	Not used
C	933 (BK/OG)	Axle switch to GEM

C7104

Clean Batt Feed Jumper Harness

1671610C1

(A) 92A (RD)
(B) 92-G(WH)

Trans Harness



1671611C1

V8 Engine Harness or LCT Trans with CAT	Allison MD Trans
(A) 103 (WH/RD)	(A) 136 (DB/YE)
(B) 570 (BK/WH)	(B) 143 (LB/YE)

C7205

Vehicle interface wiring (VIW) A

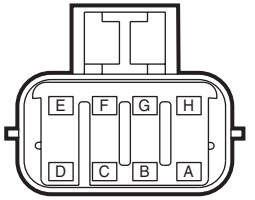

3525872C1

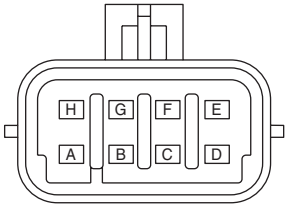

Cap 3525874C1

Pin	Circuit	Circuit Function
A	161 (DG/OG)	ABS event
B	114 (LB/YE)	Neutral indicator
C	—	Not used
D	112 (BK/YE)	PTO enable
E	—	Not used
F	167 (BN/OG)	Output speed
G	105 (RD/WH)	Sump temperature
H	137 (YE/BK)	Service brake status

C7206

Vehicle interface wiring (VIW) C

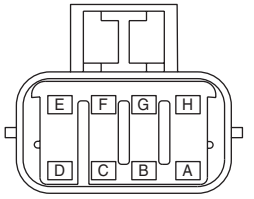

Cap 3525872C1

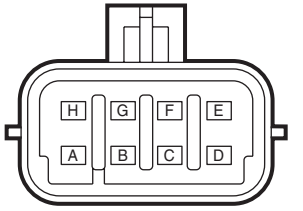

3525874C1

Pin	Circuit	Circuit Function
A	155 (GY/RD)	Aux range inhibit
B	117 (PK/BK)	Auto neutral for PTO
C	161 (DG/OG)	ABS event
D	118 (PK/OG)	Pump mode
E	153 (VT/YE)	Aux hold
F	177 (WH)	Direction change enable
G	—	Not used
H	—	Not used