Master window/door lock/unlock switch (continued)

Schematic

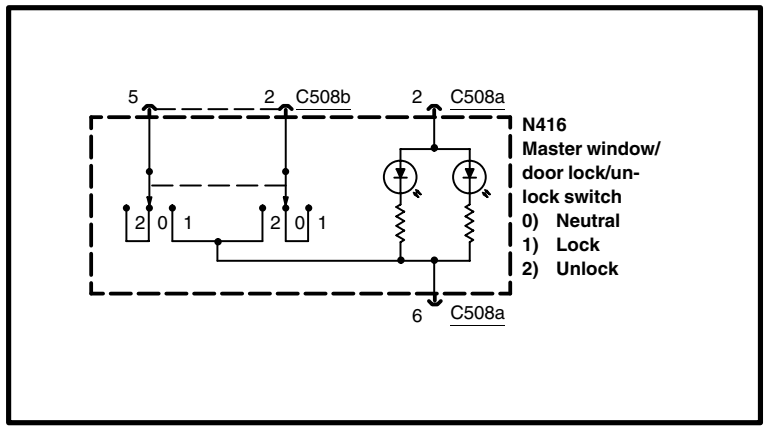

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Lock Switch Circuit	2 (508b) and 6 (508a)	Unlock	Closed circuit
		Rest	Open circuit
Unlock Switch Circuit	5 (508b) and 6 (508a)	Lock	Closed circuit
		Rest	Open circuit