Component Testing – Multifunction Switch, Lamp Portion

SCHEMATIC

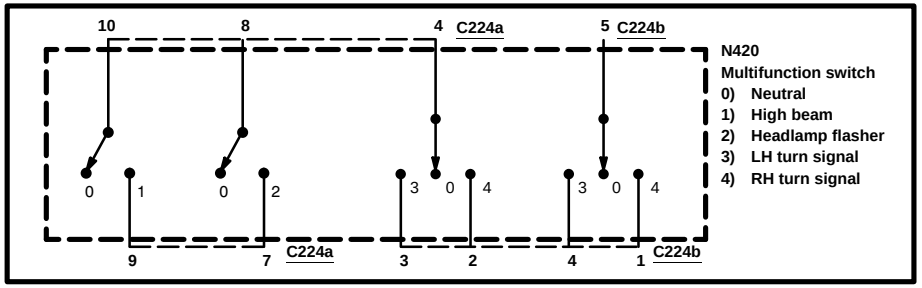

TERMINAL LOCATIONS

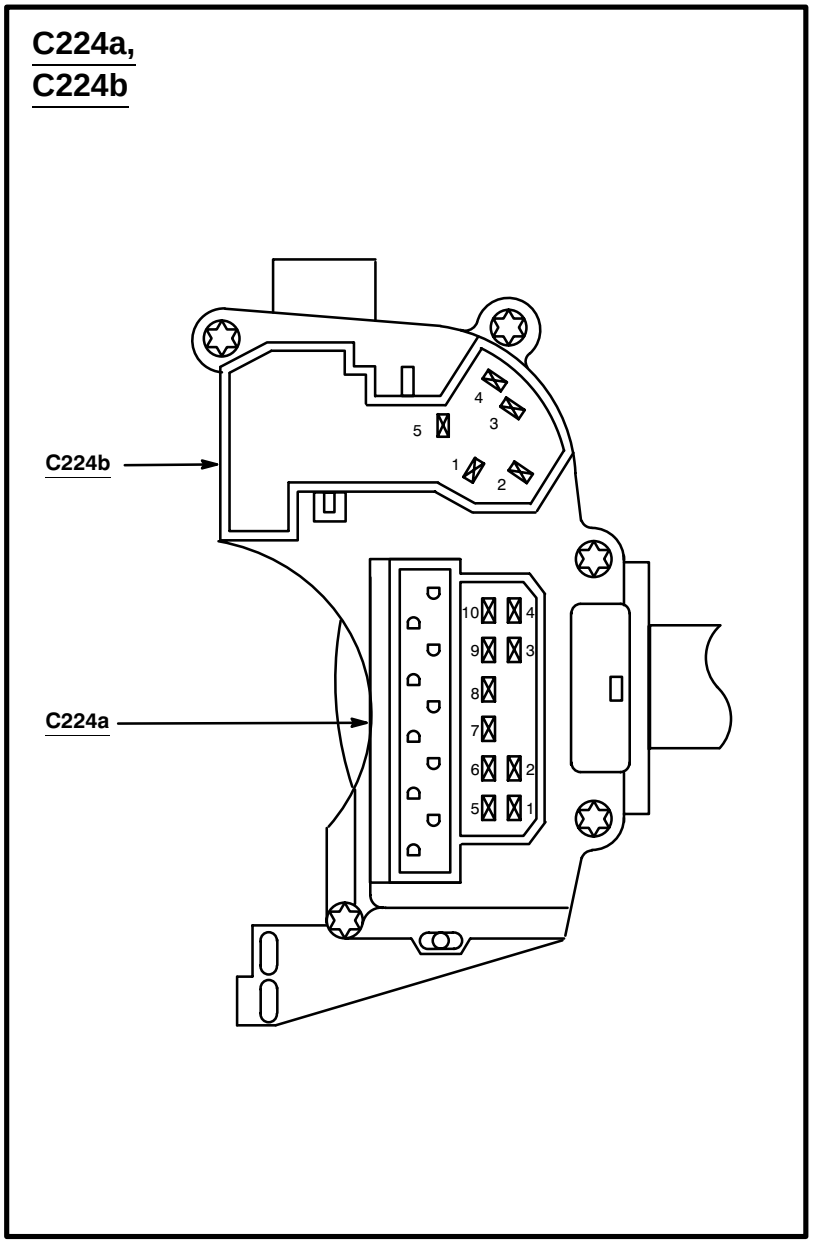

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
High Beam	10, C224a and 9, C224a	Neutral	Open Circuit
		High Beam	Closed Circuit
Headlamp Flasher	8, C224a and 7, C224a	Neutral	Open Circuit
		Headlamp Flasher	Closed Circuit
RH Turn Signal	4, C224a and 2, C224b 5, C224b and 1, C224b	Neutral	Open Circuit
		RH Turn Signal	Closed Circuit
LH Turn Signal	4, C224a and 3, C224b 5, C224b and 4, C224b	Neutral	Open Circuit
		LH Turn Signal	Closed Circuit