149-7 COMPONENT TESTING: POWER WINDOW SWITCHES

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Do Power and Ground Test Before any other test	10 and 7	LH and RH Window Switches (All Positions)	Open Circuit
	9, 15, 14, 8, 7, 13, 12 and 6	LH and RH Window Switches (At rest)	Closed Circuit
LH Window Circuit	10 and 6	Up	Closed Circuit
	10 and 13	Down	Closed Circuit
RH Window Circuit	11 and 8	Up	Closed Circuit
	11 and 15	Down	Closed Circuit

TERMINALS

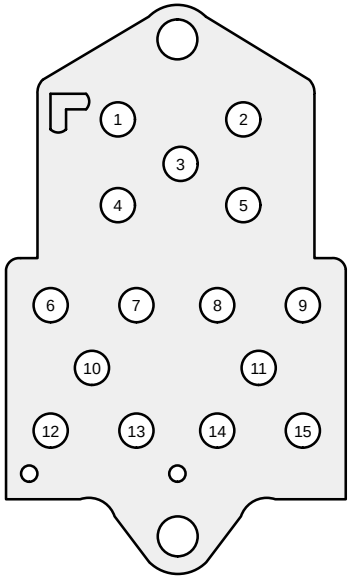
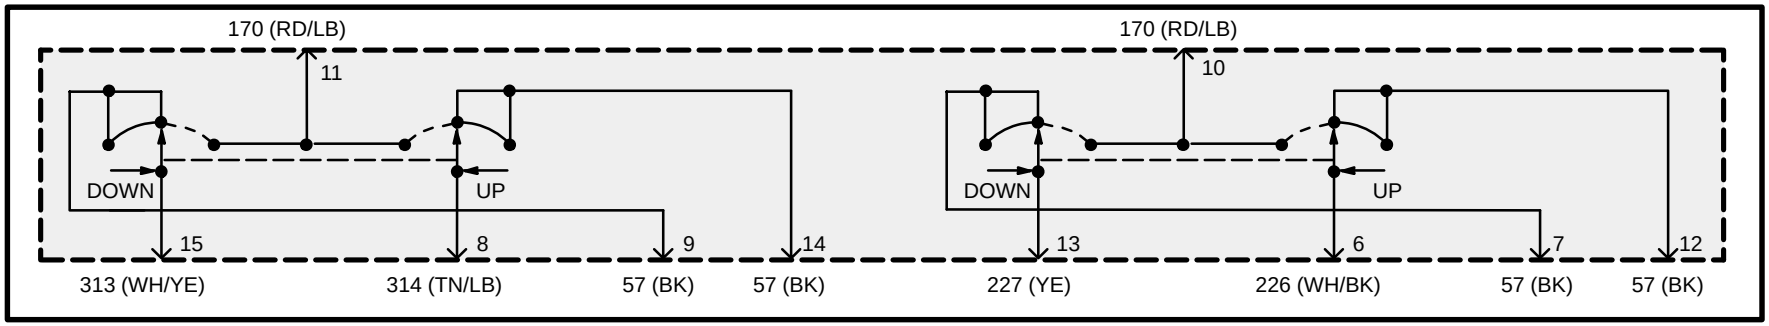
SCHEMATIC