Component Testing – Headlamp switch, Exterior lamps

SCHEMATIC

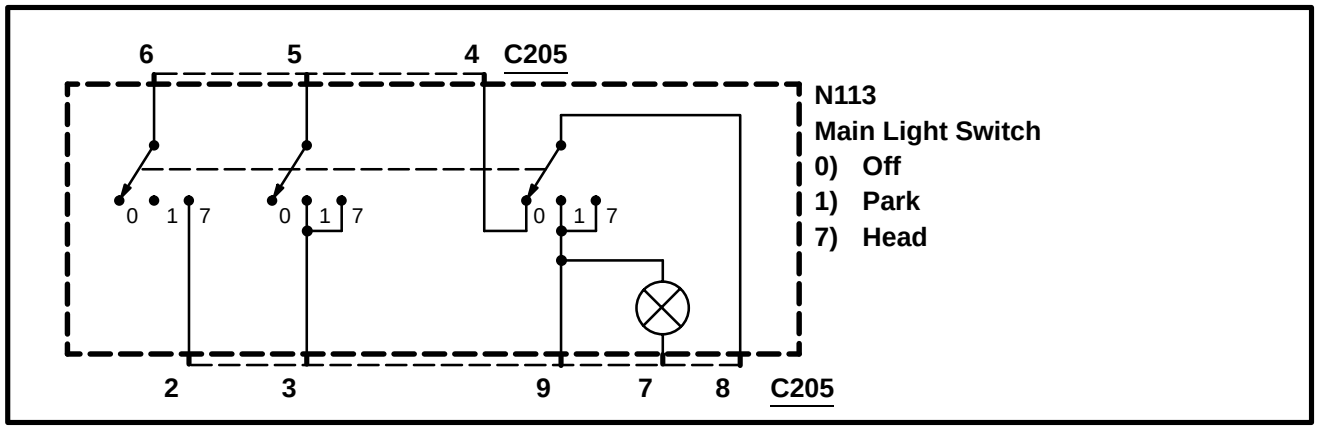

TERMINALS

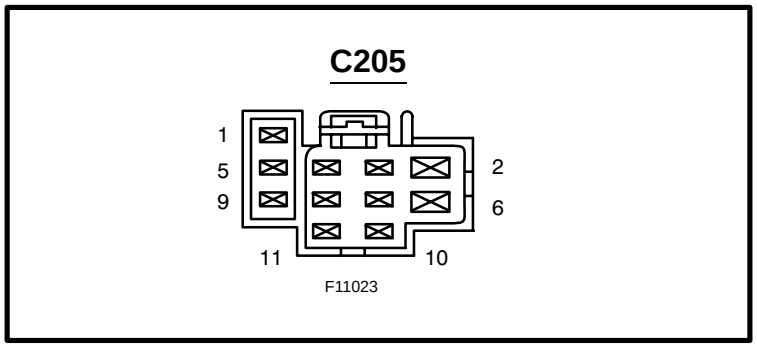

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Headlamp	6 and 2	Off	Open Circuit
		Head	Closed Circuit
		Park	Open Circuit
Park Lamp	4 and 9	Off	Open Circuit
		Head	Closed Circuit
		Park	Closed Circuit
Fog Lamps	5 and 3	Off	Open Circuit
		Head	Closed Circuit
		Park	Closed Circuit