C140

18C619

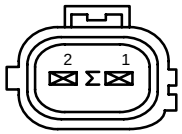

F02106

14305

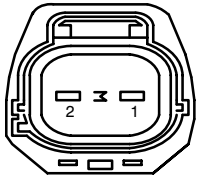

F02074

(1) –

(2) 50-BB10 (GY/BK)

C141 (BU)

7C078

Heated Oxygen Sensor (HO2S) #22 (9G444)

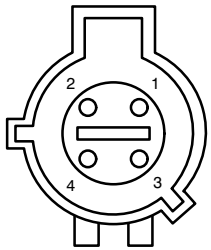

F04082

Pin	Circuit	Circuit function
1	15S-RJ26 (GN/BK)	Voltage, ignition switch in Start or Run (not overload protected), Switched
2	91S-RJ26 (BK/GN)	Ground, Switched
3	9-RJ26 (BN/GN)	Sensor signal return (reference/ground)
4	8-RJ26 (WH/GN)	Sensor signal

C142 (BU)

7C078

Heated Oxygen Sensor (HO2S) #12 (9G444)

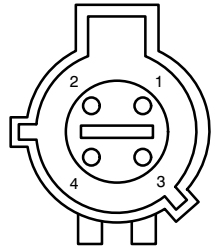

F04082

Pin	Circuit	Circuit function
1	15S–RJ25 (GN/RD)	Voltage, ignition switch in Start or Run (not overload protected), Switched
2	91S-RJ25 (BK/OG)	Ground, Switched
3	9-RJ25 (BN/BU)	Sensor signal return (reference/ground)
4	8-RJ25 (WH/BU)	Sensor signal

C143

7C078

Turbine shaft speed sensor (7H103)

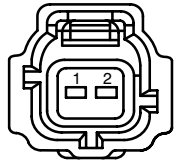

F02066

Pin	Circuit	Circuit function
1	8-TA27 (WH/VT)	Sensor signal
2	9-TA27 (BN/WH)	Sensor signal return (reference/ground)