Schematic

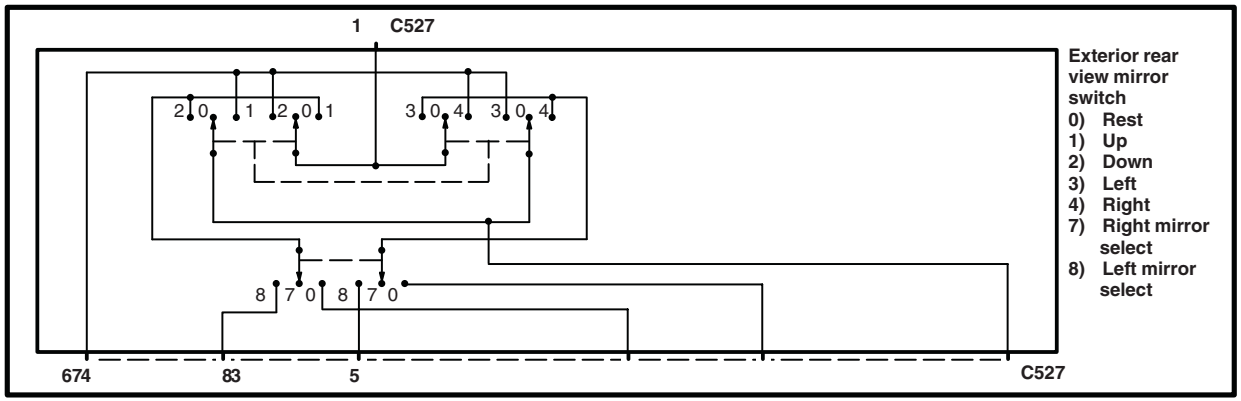

Terminals

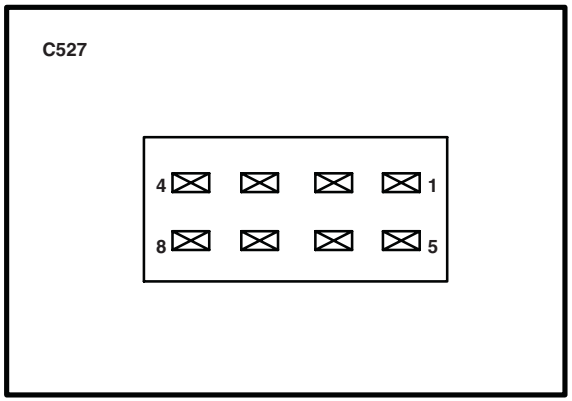

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Left mirror	**Selector switch Left**		
Up	1 and 7 6 and 5	Up	Closed circuit
Down	1 and 6 7 and 5	Down	Closed circuit
Left	1 and 4 6 and 5	Left	Closed circuit
Right	1 and 6 4 and 5	Right	Closed circuit
Right mirror	**Selector switch Right**		
Up	1 and 8 6 and 5	Up	Closed circuit
Down	1 and 6 8 and 5	Down	Closed circuit
Left	1 and 3 6 and 5	Left	Closed circuit
Right	1 and 6 3 and 5	Right	Closed circuit