C140 (BK)

12A581

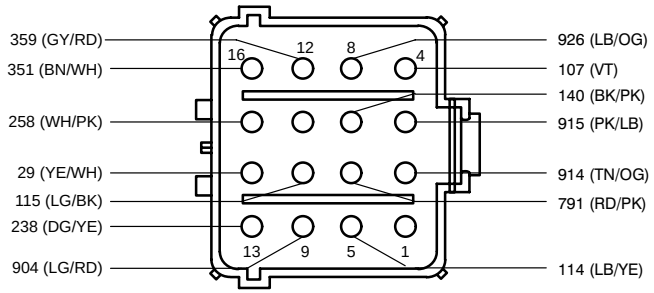

F16020

14290

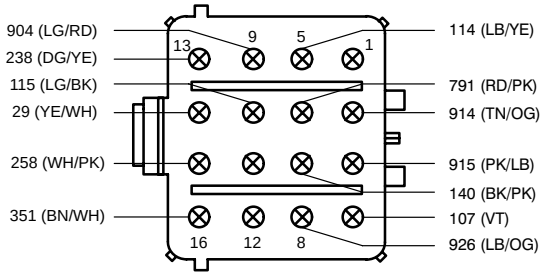

F16036

C141

12A581

B87
Heated Oxygen
Sensor (HO2S) #22
(9F472)

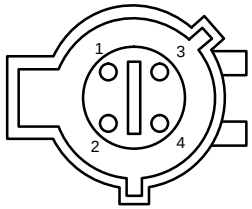

F04251

Pin	Circuit	Circuit Function
1	276 (BN)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9F472), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9F472), input

C142 (BU)

12A581

B88
Heated Oxygen
Sensor (HO2S) #12
(9F472)

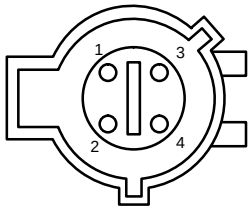

F04251

Pin	Circuit	Circuit Function
1	276 (BN)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9F472), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9F472), input

C143

12A581

B44
Turbine shaft speed
sensor (7M101)

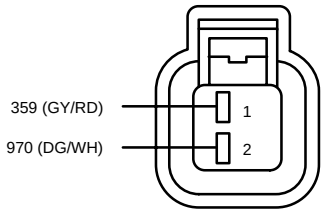

F02069

Pin	Circuit	Circuit Function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine shaft speed sensor (7M101)