Schematic

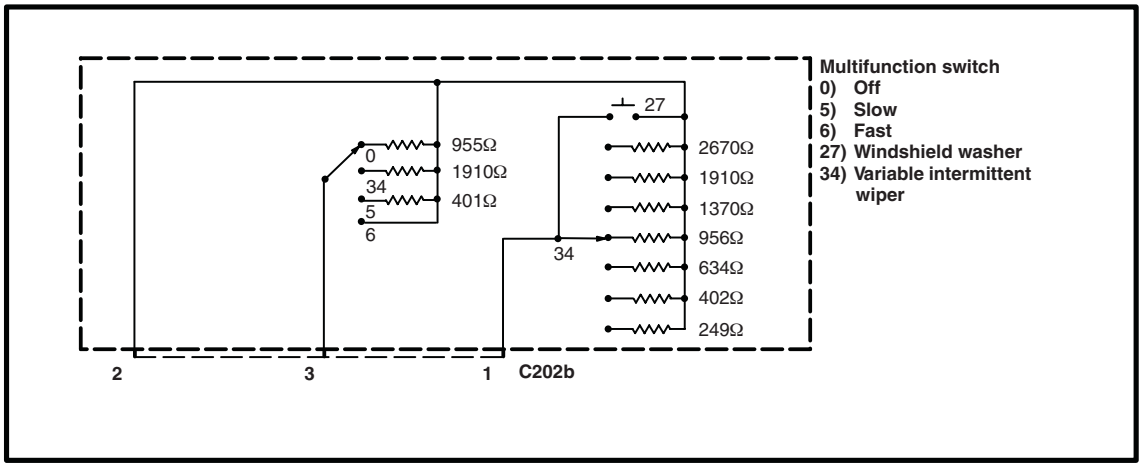

Terminals

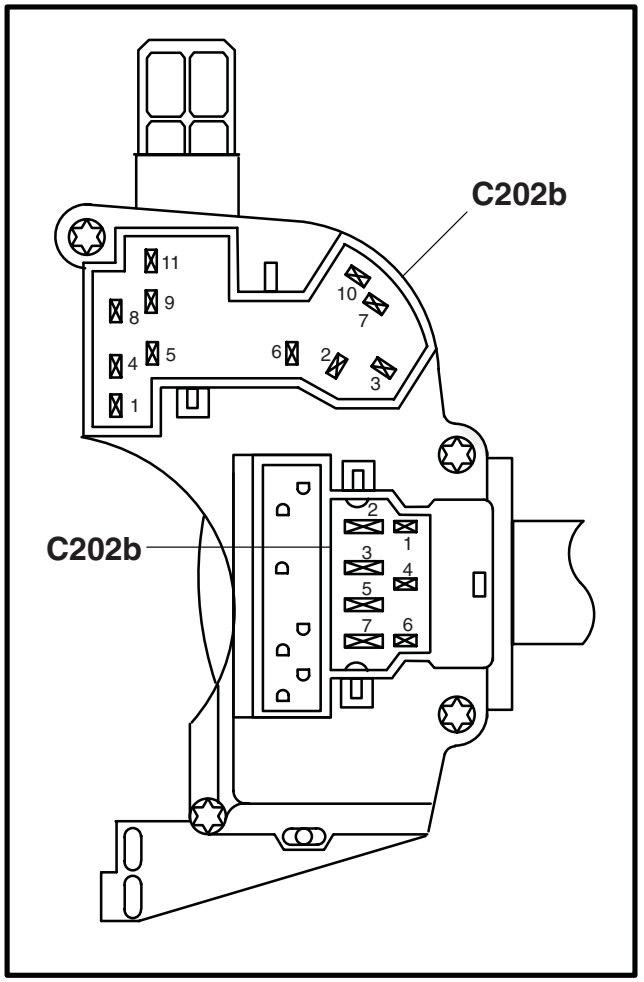

Component Testing Procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	4 and 6	Washer switch depressed	Closed circuit
		Washer switch normal	Open circuit
Wiper switch circuit	1 and 4	Off	955 Ω
		Intermittent	1910 Ω
		Normal	401Ω
		Fast	Closed circuit
Intermittent wiper circuit	4 and 6	#1 Detent	2670 Ω
		#2 Detent	1910 Ω
		#3 Detent	1370 Ω
		#4 Detent	956 Ω
		#5 Detent	634 Ω
		#6 Detent	402 Ω
		#7 Detent	249 Ω