Micro ISO -21

Schematic

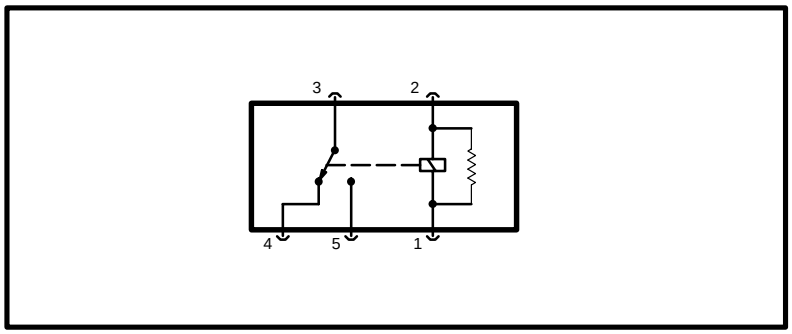

Terminal locations

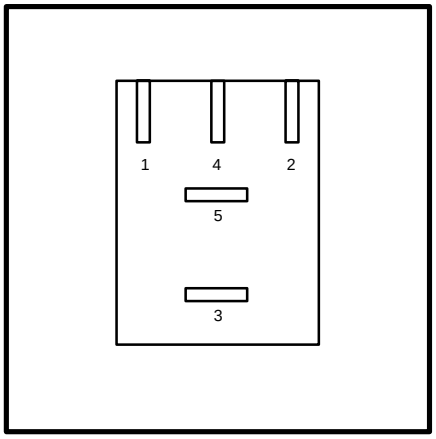

Component testing procedure (no voltage applied)

Circuit to test	Connect ohmmeter to terminals	A good relay will indicate
Coil	1 and 2	100–150 Ω
Contact	3 and 4	Closed circuit
	3 and 5	Open circuit
Coil – Contact	1 and 3	Open circuit
	1 and 4	Open circuit
	1 and 5	Open circuit

Component testing procedure (voltage applied)

Disconnect the ohmmeter; connect pins 2 and 3 to 12 V DC power and pin 1 to ground. Measure voltage between pin 5 and pin 1. If the voltage is 12 V, continue with the test. If not, replace the relay. Disconnect power from pin 2 and measure voltage between pin 4 and pin 1. If the voltage is 12 V, the relay is okay. If not, replace the relay.