COMPONENT TESTING: MAIN LIGHT SWITCH 149-2

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Basic Switch Functions	Conduct the five tests shown on standard Main Light Switch, page 149-1, using schematic and terminal locations on this page.		
Autolamp Exit Relay Rheostat	7 and 4	Rotate Flag Dial slowly Counter-clockwise from Off to Max Delay	Ohmmeter will show smoothly increasing resistance from approximately 3000 to 200,000 ohms
Autolamp On-Off Switch	7 and 4	Flag Dial to Off All Other Positions	Open Circuit Closed Circuit

TERMINALS

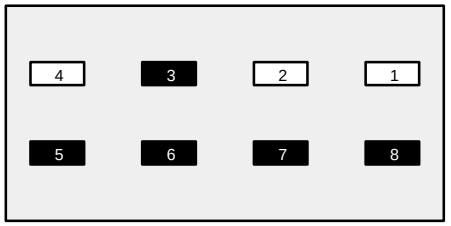

C235

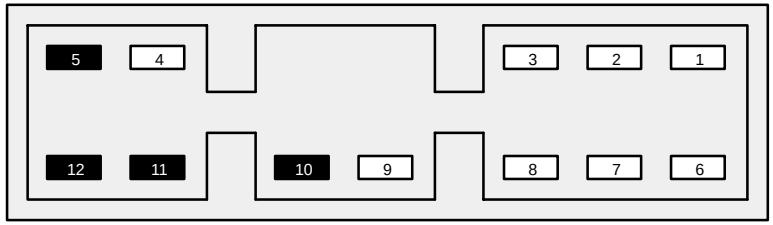

C234
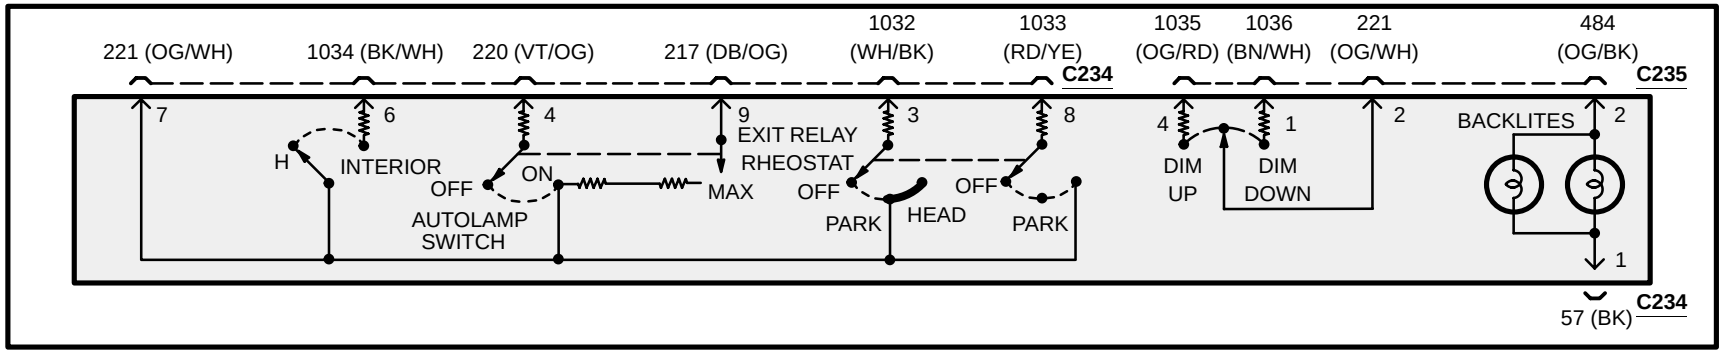
SCHEMATIC