Multifunction Switch, Lamp Portion

Schematic

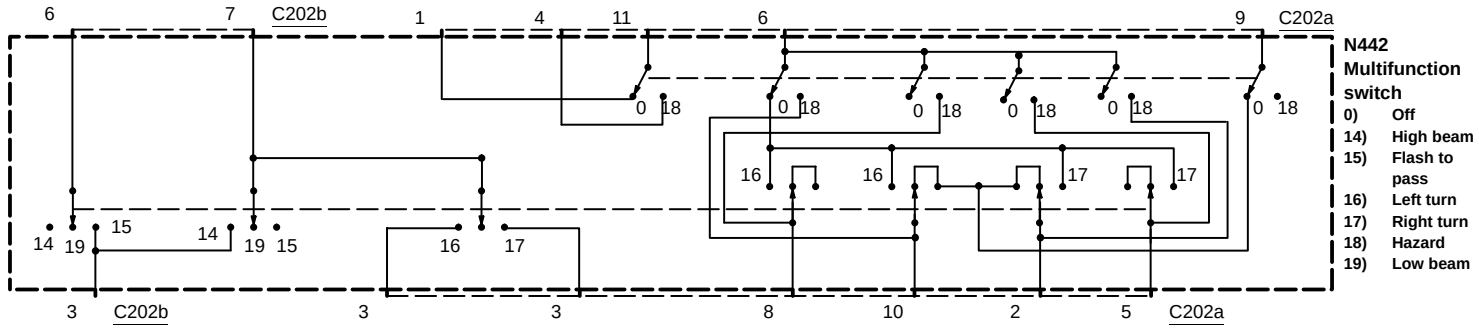

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Turn signal	6 and 9, 3	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
	6 and 2, 2	Hazard switch to Normal (Off) and Turn switch to Right	Closed circuit
Hazard	6 and 2, 3, 2, 9	Hazard switch to Hazard (On) (Button pushed in and then released to fully extended position)	Closed circuit
lamp feed Stoplamps	9 and 9, 2	Hazard switch to Normal (Off) and Turn switch to Neutral	Closed circuit
Cornering lamp	2 and 7	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
	2 and 3	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
Flash–to–pass	7 and 5	Pull and hold lever stalk toward steering wheel	Closed circuit
Low beam/Flash–to–pass	2 and 5	Lever stalk in detent away from steering wheel	Closed circuit