149-3 COMPONENT TESTING: MULTIFUNCTION SWITCH

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Turn Switch Circuits	44 and 9, 3	Hazard Switch to Normal (OFF) and Turn Switch to Turn Left	Closed Circuit
	44 and 5, 2	Hazard Switch to Normal (OFF) and Turn Switch to Turn Right	Closed Circuit
Hazard Switch Circuit	385 and 9, 5, 2, 3	Hazard Switch On (Button depressed then released to full out position)	Closed Circuit
Stoplamp Feed Through Circuit	511 and 9, 5	Hazard Switch to Normal (OFF) and Turn Switch to Neutral	Closed Circuit

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Flash to Pass Circuit	196 and 12, 15 and 507	Pull and hold Lever Stalk toward Steering Wheel	Closed Circuit
Dimmer High Beam Circuit	15 and 12	Lever Stalk in detent away from Steering Wheel	Closed Circuit
Dimmer Low Beam Circuit	15 and 507	Lever Stalk in detent toward Steering Wheel	Closed Circuit
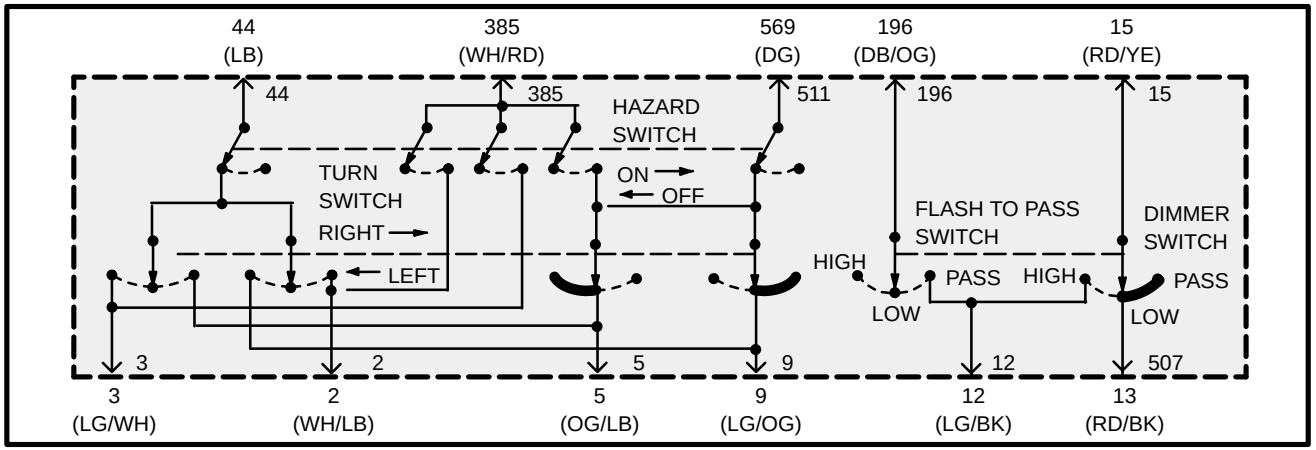
SCHEMATIC – LAMP PORTION