Multifunction Switch, Wiper/Washer Portion

Schematic

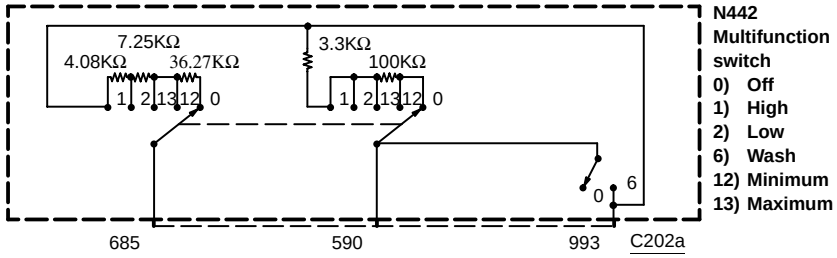

Terminals

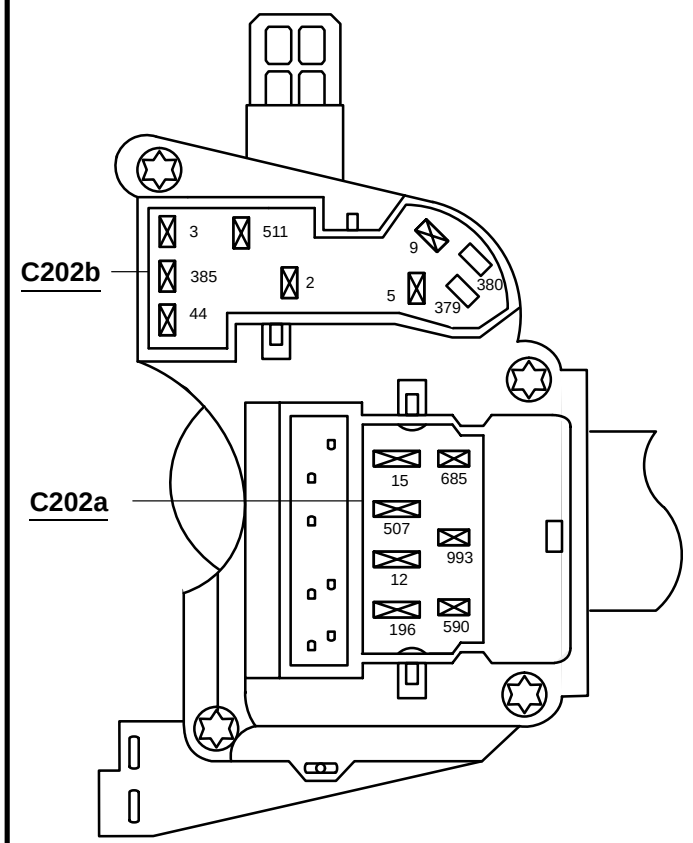

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	590 and 993	Wiper switch, Off, Washer switch normal	103.3KΩ
		Wiper switch, On, Washer switch depressed	Closed circuit
Washer switch circuit	685 and 993	Off	47.6KΩ
		Intermittent	11.33KΩ
		Low	4.08KΩ
		High	Closed circuit
Intermittent wiper circuit	590 and 993	Off	103.3KΩ
		Intermittent	3.3KΩ –103.3KΩ
		Low	3.3KΩ
		High	3.3KΩ