## C137

**14290**
**14398**

M112
Windshield washer
pump motor (17618)

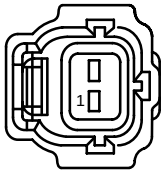


F02091

| Pin | Circuit | Circuit function |
|---|---|---|
| 1 | 488 (DG) | Windshield washer pump motor (17618), feed |
| | 941 (BK/WH) | Windshield washer pump motor (17618), feed |
| 2 | 941 (BK/WH) | Windshield washer pump motor (17618), feed |
| | 57 (BK) | Ground |

## C142 (BU)

**12B637**

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

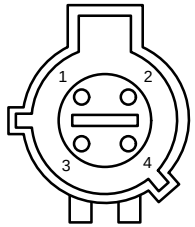


F04082

| Pin | Circuit | Circuit function |
|---|---|---|
| 1 | 389 (WH/BK) | Heated Oxygen Sensor (HO2S) #12 (9G444), heater |
| 2 | 34 (LB/OG) | Voltage supplied in Start and Run (overload protected) |
| 3 | 392 (RD/LG) | Heated Oxygen Sensor (HO2S) #12 (9G444), input |
| 4 | 89 (OG) | signal, return |

## C139

**14A280**

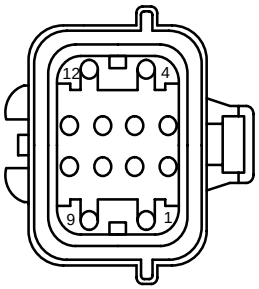


F12062

**14290**
**14398**

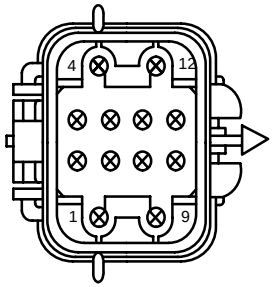


F12060

| | | | |
|---|---|---|---|
| (1) | | (7) | |
| (2) | 441 (RD/YE) | (8) | |
| (3) | 57 (BK) | (9) | 113 (YE/LB) |
| (4) | | (10) | 904 (LG/RD) |
| (5) | 570 (BK/WH) | (11) | 321 (GY/WH) |
| (6) | 253 (DG/WH) | (12) | |