Relay

Schematic

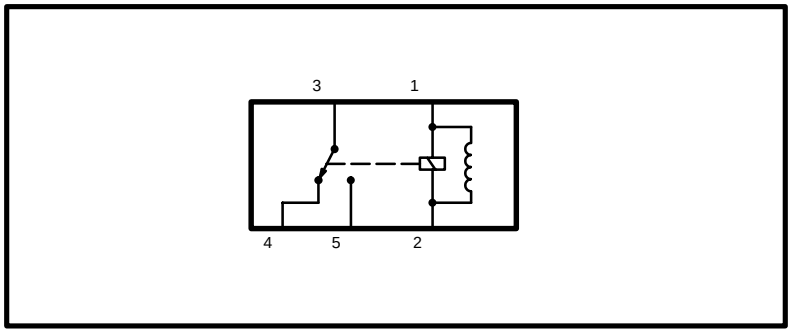

Terminal locations

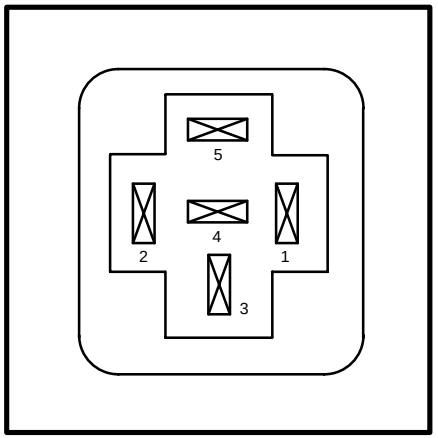

Component testing procedure, no voltage applied

Circuit to test	Connect ohmmeter to terminals	A good relay will indicate
Coil	1 and 2	50–100Ω
Contact	3 and 4	Closed circuit
	3 and 5	Open circuit
Coil, Contact	2 and 3	Open circuit
	2 and 4	Open circuit
	2 and 5	Open circuit

Component testing procedure, voltage applied

Disconnect the ohmmeter; connect pins 3 and 1 to 12V DC power and pin 2 to ground. Measure voltage between pin 5 and pin 2. If the voltage is 12V, continue with the test. If not, replace the relay. Disconnect power from pin 1 and measure voltage between pin 4 and pin 2. If the voltage is 12V, the relay is okay. If not, replace the relay.