TERMINALS

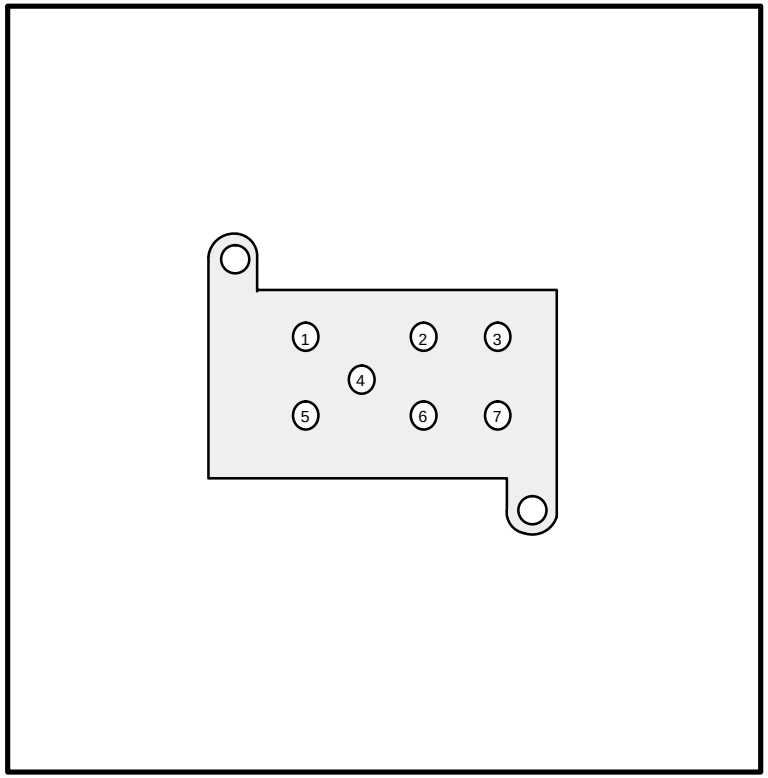

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Rear Window	4 and 5 2 and 4	Up Down	Closed Circuit Closed Circuit
Master Window Door Lock Control	2 and 6 1 and 5	Neutral Down Neutral Up	Closed Circuit Open Circuit Closed Circuit Open Circuit
Switch Illumination	3 and 7	–	Closed Circuit
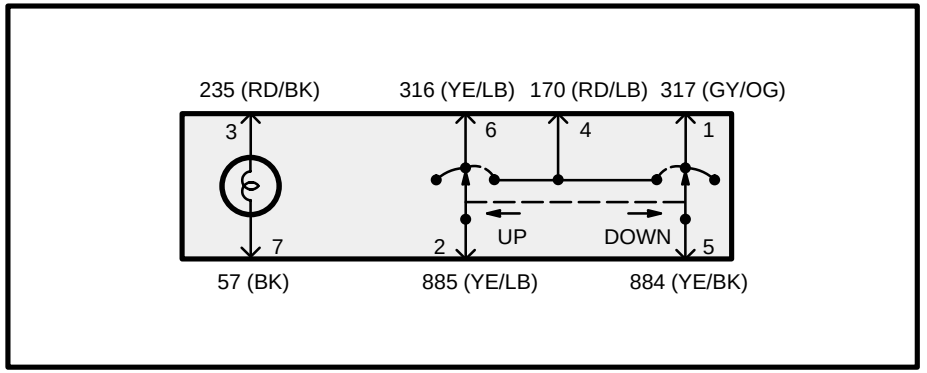
SCHEMATIC