Component Testing – Relay – Mini ISO

SCHEMATIC

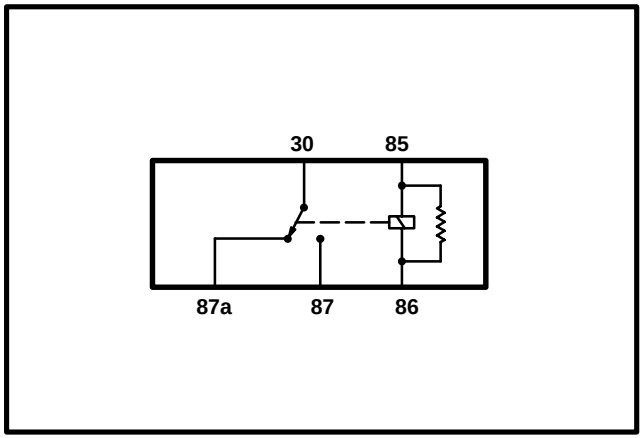

TERMINAL LOCATIONS

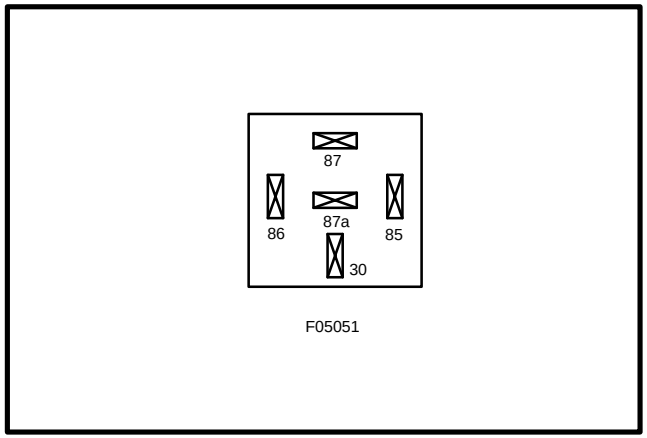

COMPONENT TESTING PROCEDURE (no voltage applied)

TO TEST	Connect Ohmmeter to Terminals	A Good Relay Will Indicate
Coil	85 and 86	50–100 ohms
Contact	30 and 87a	Closed Circuit
	30 and 87	Open Circuit
Coil–Contact	86 and 30	Open Circuit
	86 and 87a	Open Circuit
	86 and 87	Open Circuit

COMPONENT TESTING PROCEDURE (voltage applied)

Disconnect the ohmmeter; connect pins 30 and 85 to 12V DC power and pin 86 to ground. Measure voltage between pin 87 and pin 86. If the voltage is 12V, continue with the test. If not, replace the relay. Disconnect power from pin 85 and measure voltage between pin 87a and pin 86. If the voltage is 12V, the relay is okay. If not, replace the relay.