Component Testing – Relay – Micro ISO

SCHEMATIC

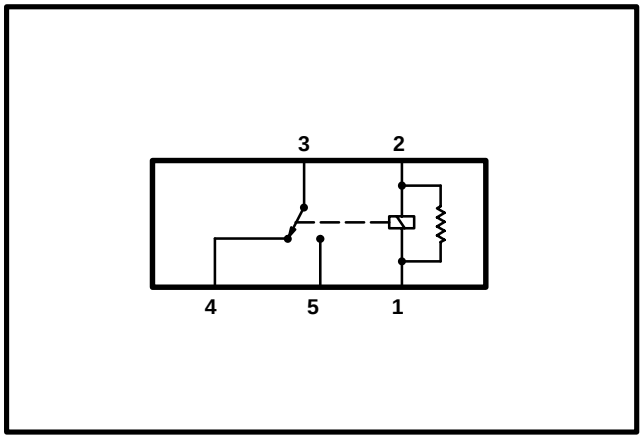

TERMINAL LOCATIONS

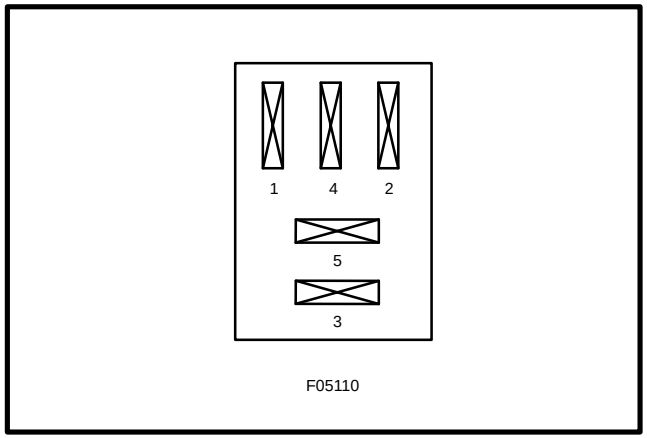

COMPONENT TESTING PROCEDURE (no voltage applied)

TO TEST	Connect Ohmmeter to Terminals	A Good Relay Will Indicate
Coil	1 and 2	100–150 ohms
Contact	3 and 4	Closed Circuit
	3 and 5	Open Circuit
Coil–Contact	1 and 3	Open Circuit
	1 and 4	Open Circuit
	1 and 5	Open Circuit

COMPONENT TESTING PROCEDURE (voltage applied)

Disconnect the ohmmeter; connect pins 2 and 3 to 12V DC power and pin 1 to ground. Measure voltage between pin 5 and pin 1. If the voltage is 12V, continue with the test. If not, replace the relay. Disconnect power from pin 2 and measure voltage between pin 4 and pin 1. If the voltage is 12V, the relay is okay. If not, replace the relay.