Component Testing – Master window adjust switch

SCHEMATIC

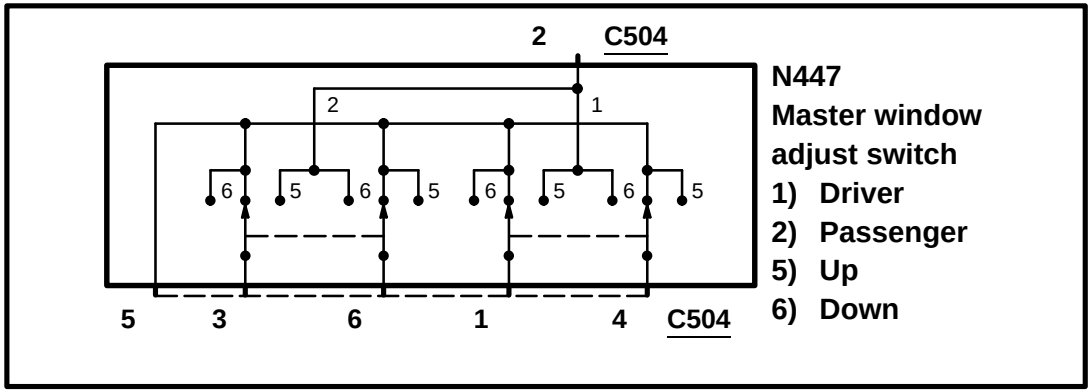

TERMINALS

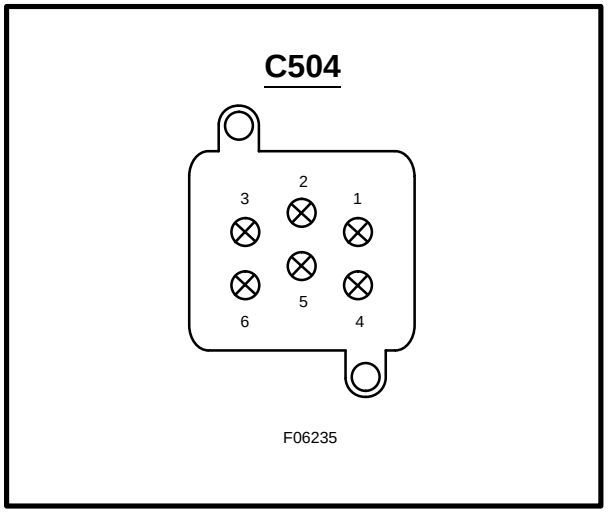

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Front Window Circuit	2 and 1	Up	Closed Circuit
	2 and 4	Down	Closed Circuit
	5 and 1 5 and 4	Rest	Closed Circuit
Right Front Window Circuit	2 and 3	Up	Closed Circuit
	2 and 6	Down	Closed Circuit
	5 and 3 5 and 6	Rest	Closed Circuit