Multifunction Switch, Turn Portion

Schematic

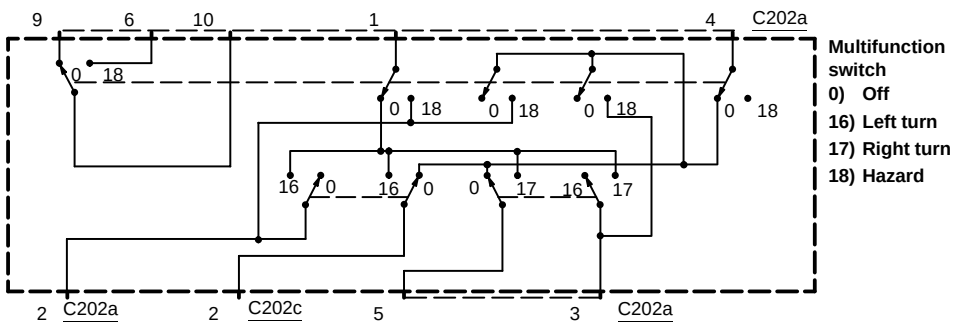

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Turn signal	1 and 2 (C202a)	Left turn, Hazard Off	Closed circuit
	1 (C202a) and 2 (C202c)		
	4 and 5 (C202a)		
	4 (C202a) and 2 (C202c)	Right turn, Hazard Off	Closed circuit
	1 and 5 (C202a)		
	1 and 3 (C202a)		
Stoplamps	9 and 10 (C202a)	Turn signal switch in neutral, Hazard Off	Closed circuit
	4 (C202a) and 2 (C202c)		
	4 and 5 (C202a)		
Hazard	6 and 10 (C202a)	Hazard On, Turn signal switch in neutral	Closed circuit
	1 and 2 (C202a)		
	1 (C202a) and 2 (C202c)		
	1 and 5 (C202a)		
	1 and 3 (C202a)		

Terminals

C202a

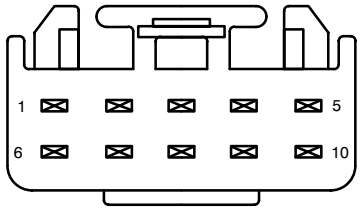
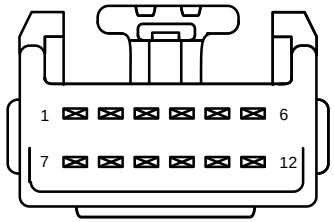
C202c