Window adjust switch, right rear (14A412)

Schematic

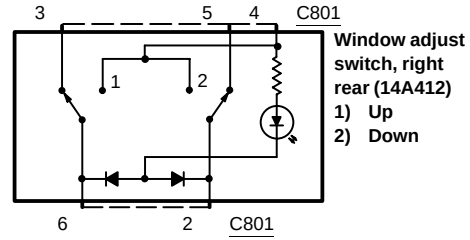

Terminals

C801

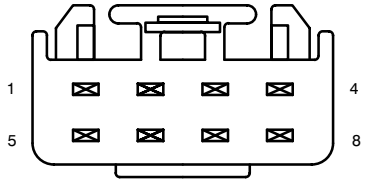

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Up Switch Circuit	4 and 6	Up	Closed circuit
	5 and 2	Up	Closed circuit
Down Switch Circuit	4 and 2	Down	Closed circuit
	3 and 6	Down	Closed circuit